

COPY

LLOYD'S REGISTER OF SHIPPING

Cert. No. 63/266



Port of Augsburg, Moritzplatz 4

15th February, 1963

F-No. 3107
402 855
G6/632
404 356
1661

This is to Certify that

Günther Haack

the undersigned Surveyor to this Society did at the request of Messrs. Maschinenfabrik Augsburg-Nürnberg A.G. of Augsburg attend their works at Augsburg on various dates for the purpose of surveying during construction one exhaust gas turbo supercharging blower set of makers' type G6/632 made to the order of Messrs. Venetsanos of Piräus/Greece.

This blower set has been constructed in accordance with the approved plans, the Secretary's letter and instructions thereto. The different casings have been subjected to suitable hydraulic test pressures and were found, so far as could be seen, to be sound and tight while under pressure and the workmanship to be satisfactory.


Admission casing	1 kg/cm ²	7.11.62
Turbine casing	3 kg/cm ²	16.1.62
Bearing casing	6 kg/cm ²	7.11.62
Blower casing	1 kg/cm ²	7.11.62

The turbine shaft has been procured from Messrs. Bochumer Verein of Bochum and has been tested by the local Society's Surveyor with satisfactory results as shown on Düsseldorf Certificate No. 61/2089 dd. 29.11.61.

The material of the blower impeller has been tested at the M.A.N. Test House with satisfactory results as shown on makers' test sheet No. 657 dd. 6.3.62.

The turbine rotors and the blower impeller have been tested with 30 % overspeed. For centrifugal test results please see makers' sheet No. 6365 I and 5787 I respectively.


For identification purposes the parts have been marked with the Surveyor's private stamp only and/or "LLOYD'S TEST AUG", the No. 1661, the test pressure, the date and the private stamp of the Surveyor: G.H.

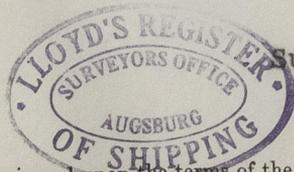

Surveyor to Lloyd's Register of Shipping.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

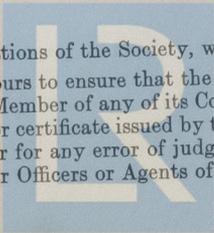

© 2021

Lloyd's Register Foundation

7810-532210-0187