

Ship's Name ~~XXXX~~MS "INDIAN REEFER" LR No. 516032

Gross tons 2600 Port of Registry Esbjerg Port Odense

Date of build Is there a rpt. 8? yes Rpt. No. 21925

No. of visits First date Last date
Interim Cert. issued & copy herewith? Damage rpt. issued & copy herewith? Last rpt. (H.Q. only)

Date of completing rpt. Surveyed at, if different from Port above

Is a rpt. 9A attached? yes MN Nature of survey Docking El. installation

Survey fees Damage fee Expenses

S.A. fee

DOCKING

Propeller good Sea connections Oil gland
Fastenings good Wear down of stern bush (if relined, state clearance before and after) S. 1.9 mm P. 2.6 mm

Has screw/tube shaft been drawn? no Date of examn.

Has shaft been changed? Has shaft now fitted been previously used?

Has shaft now examined/fitted a continuous liner? Approved oil gland?

BOILERS OPENED UP AND EXAMINED. (Identify by position and state latest date of internal examination of each boiler.)

AUXILIARY, DONKEY OR PRESS (State if oil fired—OF or exhaust gas—EG) MAIN

Air heaters

Superheaters

Safety valves

Mountings, doors and fastenings

Safety valves adjusted to Sat Spt

Boiler securing arrangements

Main economisers

Steam heated steam generators

Forced circulating pumps

Have saturated steam pipes in cylindrical boiler smoke boxes been examined as required by the Rules?

Exhaust gas heated economisers and their safety valves

Steam generator safety valves adjusted to

Funnel

Were oil burning system & remote controls examined in accordance with rules?

I recommend that the machinery of this ship remain as classed with/without fresh record of

please see rpt. 9 A

(Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate.)

Date of Committee MONDAY -4 OCT 1965

Minute See rpt 9a

012705-012710-0196



ALSO FOR
SPL FOR
NOTED BY GSR
POSTING
HEADER
CERT

At part or complete Special Surveys those items which are not applicable to the ship are to be cancelled; this need not be done when the machinery is on a continuous survey basis. When any part has been subjected to pressure test this should be stated. Engine parts when referred to by numbers should be counted from forward.

considered that re-examination or repairs should be made before that date a distinguishing mark must be inserted against the item and the circumstances and action taken or recommended described fully under "defects and repairs".

The condition of any item is to be described as "good" only when it has been examined, found or placed in good condition, and is considered to be acceptable until the due date of the next Periodical Examination. Where repairs have been effected or it is

© 2021

Lloyd's Register Foundation

EXAMINATION AND TESTING OF STEAM PIPES (state material)

MAIN  
AUXILIARY  
(over 3" bore)

Have saturated pipes in cylindrical boiler smoke boxes been tested?

Were selected copper pipes annealed?

ELECTRICAL EQUIPMENT


PROPULSION (State Port—P, or Starboard—S)		AUXILIARY	
Total kW or kVA		Total kW <del>XXXXX</del>	3 x 240 = 720 KW
a Generators		l Generators & governors	good
b Exciters			
c Air coolers		m Motors	good
d Motors			
e Air coolers		n Switchboards & fittings	good
f Control gear cables, etc.		o Circuit breakers	good
g Insulation resistance		p Cables	good
h Insulating oil test		q Insulation resistance	good
i Overspeed governors		r Steering gear <del>XXXXXX</del> motors	good
j Magnetic couplings		s Navigation light indicators	good
k Air gap			

PARTICULARS OF DEFECTS, REPAIRS, ALTERATIONS, ETC.

All three 240 KW generators completely cleaned and dried out.  
Gen. P.aft. one shunt winding renewed.  
Gen. P. forward indb. one shunt winding renewed.  
A number of defect cables renewed.

ENTERED IN ODENSE ROUGH FEE BOOK ON THE 12/8-15

The reason for repairs must be stated and those on account of damage, the alleged cause of which must be given, should be detailed separately from wear and tear repairs. State what action has been taken regarding items which are subjects of class. State also where appropriate, for the information of the Technical Records Dept., the material of the defective item and whether it is a forging, casting or welded fabrication. Any alterations in existing particulars in the Register Book should be reported above.

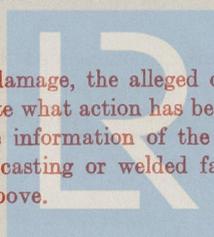

© 2021

Lloyd's Register  
Foundation