

11 JUL 1959

COPY

Bristol

LLOYD'S REGISTER OF SHIPPING

J. W. Cook & Co (Wivenhoe) Ltd No 1192.


Redshank C.

Spewit Report No 141869.

Port MANCHESTER.

C.6058.

30th June, 1959.

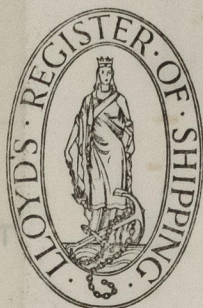

This is to Certify that

R.C. CLAYTON

the undersigned Surveyor to this Society did at the request of Messrs. David McClure Limited, attend at their Works at Stockport on the 26th June, 1959, and subsequently, for the purpose of inspecting and testing the following Generators made to Order No. 202711 of Messrs. R.A. Lister & Co. Limited, Dursley, Gloucestershire.

Two - 5 KW, 1000 RPM, 110 volt, totally enclosed, flameproof (FLP No. 3818), compound wound, continuously rated, marine type Generators Nos. 20696A and 20696B.

Each of these generators was run for a period of six hours on full load and the temperature rises recorded were within the specified limits of 40°C.

The hot compounding was checked and the generators were then run on an overload of 50% for one minute and the performance found good.

Finally, the windings were subjected to insulation resistance and pressure tests at 2 KV.

All the tests were satisfactory and the results are shown on the copies of the makers' test sheets attached hereto.

As far as could be seen the materials and workmanship employed have been good and sound.

For identification purposes the generator yokes have been stamped - L.R. R.C.C. With Date.

Fee - £6.6.0d.

Exp - £- 9.0d.

R.C. Clayton

SURVEYOR TO LLOYD'S REGISTER OF SHIPPING.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."