

LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

16 NOV 1950

REPORT ON ANNUAL LOAD LINE SURVEY.

Name of Ship "BARON FAIRLIE" Official Number 146719 Port of Registry Ardrossan
 Place of Survey Hull Dates of Survey 13.7.50. 16.8.50. 31.8.50.
5.9.50. 27.9.50. 12.10.50. Date of last Load Line Survey 1948

PARTICULARS OF SURVEY.

Items examined.	Condition in which found.	Repairs. Necessary.	Date effected.
HATCHWAYS, INCLUDING SMALL HATCHWAYS.			
1. Exposed on freeboard deck.		Repairs as follows carried out at this time:- Hatch coamings cropped & part renewed as necessary. ✓ B.A. stiffeners renewed as necessary. ✓ Hatch to poop deck plated over. ✓ Beam sockets renewed or repaired as necessary. ✓ Cleats renewed as necessary. ✓ Tonnage openings in poop plated over. ✓ Forecastle front renewed with 2 tonnage openings only. ✓ Hold ventilators cropped and part renewed. ✓ All port lights in cargo spaces and in forecastle blanked off. ✓ All storm valves reconditioned. ✓ Approx. 60% hatch covers renewed and fitted with strapping. ✓ Tarpaulins renewed as necessary. ✓ Sundry minor repairs effected. ✓ Load Line marks recut. ✓	12.10.50.
Coamings, their stays and stiffeners ...	satisfactory		
Beams ...	"		
Fore and afters ...	none		
*Covers ...	satisfactory ✓		
*Tarpaulins ... (State number per hatchway) (3)	" ✓		
*Cleats and battens ...	"		
Lashings and their fittings ...	"		
Wedges ... (Is supply, including spares, adequate ?) (Yes)	"		
2. Exposed on superstructure decks, including raised quarter decks.			
Coamings, their stays and stiffeners ...	"		
Beams ...	"		
Fore and afters ...	none		
*Covers ...	satisfactory		
*Tarpaulins ... (State number per hatchway) (3) Bunkers (2)	" ✓		
*Cleats and battens ...	"		
Lashings and their fittings ...	"		
Wedges ... (Is supply, including spares, adequate ?) (Yes)	"		
3. Within superstructures not intact or not protected by Class I closing appliances.			
Coamings ...	"		
Beams ...	"		
Fore and afters ...	none		
Covers ...	satisfactory		
Tarpaulins ... (State number per hatchway) (2)	" ✓		
Cleats and Battens ...	"		
Wedges ... (Is supply, including spares, adequate ?) (Yes)	"		
VENTILATORS IN EXPOSED POSITIONS.			
4. To spaces below freeboard deck.			
Coamings, their supports and deck connections ...	satisfactory ✓		
Closing arrangements ...	"		
5. To spaces below decks of superstructure which are intact or closed by Class I appliances.			
Coamings, their supports and deck connections ...	" ✓		
Closing arrangements ...	"		
AIR PIPES.			
6. Exposed on freeboard and superstructure decks.			
Closing arrangements ...	" ✓		
7. Within partially enclosed superstructures.			
Closing arrangements ...	-		
MACHINERY CASINGS.			
8. Casing Top.			
Fiddley openings, their covers and fastenings ...	satisfactory ✓		
Skylights, their fastenings, covers and lashings ...	"		
9. Exposed on freeboard and raised quarter decks.			
Doors and fastenings ...	-		
10. Exposed on superstructure decks other than raised quarter decks.			
Doors and fastenings ...	satisfactory ✓		
11. Within partially enclosed superstructures.			
Doors and fastenings ...	"		
12. FLUSH BUNKER SCUTTLES and chain attachments			
	none ✓		
13. COMPANIONWAYS, including deckhouses enclosing ladderways.			
Doors, fastenings, covers ...	satisfactory ✓		

* Tarpaulins, battens, covers, etc., to be examined in place as well as separately (see Ministry of Transport Circular 1687, paragraph 117 (i)).



© 2021

Lloyd's Register
Foundation

Items examined.	Condition in which found.	Repairs.	
		Necessary.	Date effected.
14. CLOSING APPLIANCES FOR OPENINGS IN SUPER-STRUCTURE BULKHEADS.			
Forecastle ... weatherboards in channels.	satisfactory ✓		
Bridge, fore end ... steel doors ...	" ✓		
Bridge, after end weatherboards in channels	" ✓		
Poop ... no openings ...	-		
15. GANGWAY, CARGO AND COALING PORTS.			
In ship's side and superstructures ...	none ✓		
16. SCUPPERS AND SANITARY DISCHARGE PIPES.			
Valves ...	satisfactory ✓		
17. SIDE SCUTTLES AND DEADLIGHTS ...	" ✓		
18. GUARD RAILS ...	" ✓		
19. PROTECTION AND ACCESS TO CREW'S QUARTERS.			
Gangways ...	none ✓		
20. LIFELINES (fittings and material) ...	satisfactory ✓		
21. FREEING PORTS.			
Shutters ...	-		
Protection bars ...	satisfactory ✓		
22. TIMBER, TANKER OR SPECIAL STEAMER LOAD LINES.			
Fittings or appliances ...	-		
23. ITEMS NOT INCLUDED IN THE FOREGOING.	-		
24. LOAD LINE MARKS ...	correct		

Certificate A. To be signed by Surveyor in respect of a partial or complete survey.

I have surveyed the ship named at the head hereof, to the extent indicated below, in accordance with the instructions contained in Ministry of Transport Circular 1687, and the requisite details of the survey have been entered herein.

Index Nos. of items examined. († Insert "all" in case of a complete survey.)	Signature of Surveyor.	Place.	Date.
All	<i>Thos. L. Dixon</i>	Hull	12th October, 1950.

Certificate B. To be signed by Surveyor completing the survey.

I am satisfied

- (i) that the fittings and appliances for the protection of openings, the guard rails, the freeing ports and the means of access to the crew's quarters have been maintained on the ship in as effective a condition as they were in when the certificate was issued; and
- (ii) that no material alterations have taken place in the hull or superstructures of the ship which affect the positions of the load lines.

I have endorsed the Load Line Certificate and the certified copy as follows:—

Signature of Surveyor *Thos. L. Dixon* Place Hull Date 12.10.50.

Signature *Thos. L. Dixon*


Date 27th October, 1950.

B.C. Fee £8 + £2 = £10.

Number of Visits 6

Particulars of any change from the conditions given on the Load Line Certificate or on Form C 11 should be reported on Form C 11 (contd.) and attached to the Form C 11 on the Ship, a copy being forwarded to the Freeboard Department.

Surveyors should note that there is only one valid certificate, and the above endorsement should be made thereon. No entry should be made on a certified copy of the certificate unless the original certificate has been produced to and endorsed by the Surveyor.

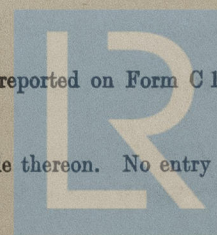

© 2021

Lloyd's Register
Foundation

G.H.W.
20 NOV 1950