

# REPORT of SURVEY for REPAIRS.

No. 1106 Survey held at Glasgow Date 11th July 1855

on the Barge Pioneer Master John Ogilvie

Tonnage 432 Built at Pillar When built 1853

By whom built                      Owners W. J. Salveson

Port belonging to Chargemouth Destined Voyage Batavia & Singapore

If Surveyed Afloat or in Dry Dock Patent Slip & Afloat

Last Survey, No. 2386 Port Leith Classed 7 A. 1.

REPAIRS Repairs of Damage; Stipped the Yellow Metal Sheathing  
and Cleaned the Bottom; put in 4 Pairs of Additional Iron  
Riders with Nuts Connected to Hold Beams extending to  
below the turn of Bilges and One Iron Lower Breasthook  
Bolted through and Clenched with Yellow Metal  
Renewed One Hold Beam Knee and a number of  
started Greenails in the Bottom  
Canthied over all and Re-sheathed the Bottom with Yellow  
Metal over Sill to the 14 1/2 feet Water Line  
Fished the Main Mast on Aft side

## Present Condition of the

Decks	<u>Good</u>	Treenails	<u>Good</u>	Windlass and <del>Caps</del> <u>Good</u>
Waterways	<u>do</u>	Breasthooks and Stemson	<u>do</u>	Pumps <u>2 Metal do</u>
Comings	<u>do</u>	Transoms, Pointers, and Crutches	<u>do</u>	Boats <u>do</u>
Upper Deck Beams & Fastenings	<u>do</u>	Timbers of the Frame <u>When Seen do</u>		Masts, Yards, &c. <u>do</u>
Lower Deck Beams & Fastenings	<u>do</u>	Keelsons	<u>do</u>	Sails <u>do</u>
Planksheers	<u>do</u>	Clamps and Shelves	<u>do</u>	Anchors No. of <u>3 B 1 1/2 Iron Wedge</u>
Sheerstrakes	<u>do</u>	Ceiling	<u>do</u>	Cables <u>Good</u>
Twelves	<u>do</u>	Rudder	<u>do</u>	Hawsers and Warps <u>do</u>
Bottom) and Counter	<u>do</u>	Copper <u>Yellow Metal</u> When put on <u>July 55</u>		Standing & Running Rigging <u>do</u>

Observations and Opinion, No in good efficient Condition fit for the  
Conveyance of Dry and Perishable Cargoes to and from  
parts of the World and to Continue as Chased

Amount of Fee.....£ 1 : : is received by me,


Special.....2 : 2 :

Certificate (if required) : : :

Committee's Minute 27th July 1855

Character assigned 7 A. 1.

recor damage repair

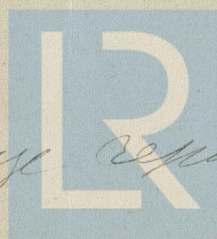

© 2019

Lloyd's Register  
Foundation

GLS141-0465