


Glasgow Report No. 68743.

LLOYD'S REGISTER OF BRITISH AND FOREIGN SHIPPING.

No. 1630

(Received in London Office,

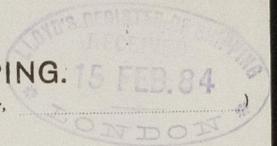

TESTS OF BOILER STEEL.

Tests of ⁴40 Steel plates manufactured by The Steel Co. of Scotland of Blochairn Glasgow for Boiler No. 336 to be constructed by Messrs J. Powden of Glasgow for S.P. No. 26 building by Messrs Napier, Shanks, & Bell
 Date first visit _____ last visit 2/2/84 No. of Visits _____

The _____ specified in the accompanying copy of Advice Notes were rolled from _____ charges. The tensile test has been applied to 3 samples as set forth below, and the temper and bending tests as required by Circular 7043A

When a second test is applied, the result should be recorded immediately below the record of the original test. The number of plates or bars included in a rejection must be clearly stated.

No.	Purpose.	Charge Mark.	No. of plates or bars in same charge	Mark on plate and test piece.	Dimensions.			Ultimate Stress.		Exten. in 8 ins.	Remarks.
					Thickn.	Brdth.	Area.	Total.	Sq. Inch.		
					Ins.	Ins.	Ins.	Tons.	Tons.		
1	Front tube plate	M 490		4831	.755	1.13	.875	24.0	27.4	27.	The remainder of the plates divided were tested by the Steel Co. & the results stamped upon each plate. 4 Rolled from 12 plates.
2	Bottom front	H 534		8506	.66	1.13	.745	20.85	27.9	24.	
3	Top	J- 8540		8567	.82	1.14	.934	24.65	26.3	26.5	

J.P.
15/2/84

GLS201-0159

Fee £ : :
 Expenses £ : :
 £ : :

To be paid by The Steel Co.

© 2021 James Webb
 Surveyor, Lloyd's Register
 Glasgow 4/2/84
 Foundation