

Damage Repairs. 28055

REPORT of SURVEY for REPAIRS.

No. Survey held at London Date Jan^y 1st 8th 1867
 on the Iron screw steamer "Ryhope" Master J. Douglass
 Tonnage 698 Built at Sunderland When built 1860 - 3 mo
 By whom built Owners J. Taylor
 Port belonging to London Destined Voyage Sunderland
 If Surveyed Afloat or in Dry Dock afloat, Victoria Dock

Last Survey, No. 5715 Port Shore Classed 9 A.1
 (t.s. 66)

REPAIRS Now done in consequence of damage -

On the Starboard Bow - two plates, one of fore-castle
 lifts, and one of the strake below the sheerstrake, renewed:
 the upper portions of two frames cut off and renewed, fitted
 with angle-iron butt straps rivetted to them and to the plating:
 a fore-castle beam, eighteen feet of main rail, fourteen feet of
 topgallant rail with berthing and stanchions, and eight strakes
 of fore-castle deck, renewed. The fore-castle deck, and the
 main deck forward in way of damage, caulked.

Present Condition of the

Decks	Free-nails	Rivets	Windlass and Capstan
Waterways	good	Breasthooks and Stemson	Pumps
Comings		Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	where	Timbers of the Frame at the openings	Masts, Yards, &c.
Lower Deck Beams & Fastenings		Ditto Ditto at other places	Condition, how ascertained
Planksheers	seen	Keelsons	Sails
Sheerstrakes		Clamps and Shelves	Anchors No. of
Topsides	not seen	Ceiling	Cables
Wales		Rudder	Hawsers and Warps
Plank (Bottom) and Counter		Copper Paint When put on	Standing & Running Rigging

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. good where seen

She is now in good and efficient condition fit
 in my opinion to remain as classed 9 A.1.

The Amount of Fee.....£ 2 : - is received by me,


Special.....: -:

Certificate (if required) : -:

Committee's Minute 29th January 1867

Character assigned 9 A.1

record damage repairs

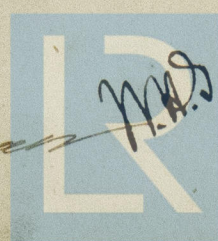

© 2019

Lloyd's Register
 Foundation

IRON440 - 0308