

# Report of Survey for Repairs of Engines and Boilers.

No. 1107 on the Screw Steamer "Sultan" Owners R H Green Port belonging to London

Date, first Survey 1890 Last Survey Sep 13<sup>th</sup> 1876

Tons 2309 Years assigned 100 A 1 Character in Register Book 6.75

Diameter of Cylinders 38" x 66" Length of Stroke 39 Pressure of Steam 60 lb Nominal Horse Power 240

Engines made at London By whom made Ravenhill & Sons & Co When made 1873

Particulars of Repairs and Examination Boilers have been thoroughly overhauled and repaired, about 30 new tubes have been fixed. Superheaters, are entirely new. Engines - General overhaul, besides which a new liner has been fitted to High Pressure Cylinder, new ends to both piston rods, carrying them through the cylinder covers new glands & stuffing boxes fitted to centre of cylinder covers new wheels to circulating engines. New Crank shaft fitted and new braces to eccentric straps.


The Amount of Fee ... £ 187 received by me, James Milton

Certificate (if required) ... £ 187

(Travelling Expenses, if any, £           )

Committee's Minutes

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

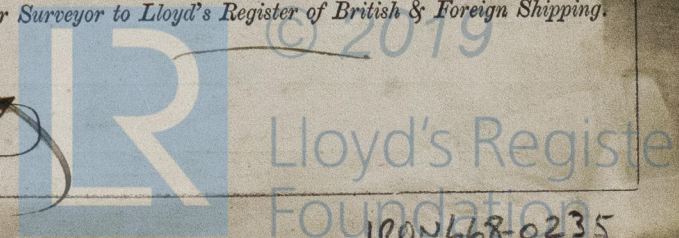

(Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.)

(The Surveyors are requested not to write on or below the space for Committee's Minutes.)

Print with the report