

# Report of Survey for Repairs of Engines and Boilers.

No. 25919

No. in Reg. Book. Survey held at

Liverpool

Date, first Survey 26<sup>th</sup> Nov

Last Survey 31<sup>st</sup> Jan 1878

26 on the

S.S. "Hankin"

Master

M. Brace

1830-2423-2202

Owners Watts, Milburn & Co

Port belonging to London

Classed

Years assigned.

Character in Register Book.

100A1

Lloyds M.C. 49ma 1876

Number of Cylinders 1 of 38 1/2" 1 of 70"

Length of Stroke 48"

Pressure of Steam 70 lbs.

Indicated Horse Power 300

Engines made at

London

By whom made

Maudslayi & Field

When made 1872.  
N.B. 1876.

## Particulars of Repairs and Examination.

Engines. Cylinder covers & valve casing doors removed. pistons valves and cylinders examined and found good. Air Circulating pumps and condenser opened out examined and overhauled. Sea cocks and chests overhauled. A new crank shaft fitted. Bilge suction pipes repaired. One plummer block refastened.

Boilers. opened out cleaned. and found good. Iron conducting composition on Boilers renewed. Safety valves overhauled. The engines and Boilers tested under steam and found satisfactory.

The Engines and Boilers of this vessel being in an efficient condition I am of opinion she is eligible to retain the notification Lloyds M.C. (in red) and be marked from this date.

The Amount of Fee ... £2 2 : : received by me,

Certificate (if required) ... £ : : 2/2 1878


(Travelling Expenses, if any, £

Committee's Minute Liverpool Feb 8<sup>th</sup> 1878

Lloyd's M.C. in red 178

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

J. G. Wigham

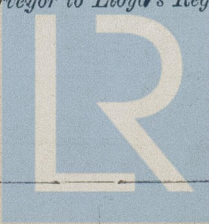

Lloyd's Register Foundation