

20680

Report of Survey for Repairs of Engines and Boilers.

(No. 28/4/78)

No. 4644
 Reg. Book. 689 on the Glasgow Survey held at Glasgow Date, first Survey April 9th Last Survey April 17th 1878
 Owners British & Business S.S. Co. Limited Port belonging to Glasgow Tons 2464
 Years assigned 100 A. 1 Character in Register Book 5-74

Diameter of Cylinder 3 45" x 48" Engines made at Greenock When made 1874
 Length of Stroke 45" By whom made Greenock Laundry Coy
 Pressure of Steam 65 lbs
 Nominal Horse Power 300

Particulars of Repairs and Examination Cylinders opened, & Pistons & Slide Valves examined & overhauled. Crank Shaft journals & Pins examined all pumps, pipes & hoses examined, Sea, Cocks & Valves overhauled in Dry Dock

Boilers. Cleaned & examined, a small patch fitted at back furnace in Starboard. Forward Boiler & Safety Valves overhauled


The above repairs have been satisfactorily completed by Messrs W. King & Coy. and the Engines & Boilers are now in good condition & safe working order, and eligible in my opinion to be noted in the Register Book Lloyd's M.C.S. 78.

Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.

The Amount of Fee ... £ 3 : 3 : received by me, Apr 26th
 Certificate (if required) ... £ : : April 1878
 (Travelling Expenses, if any, £)

James Morrison
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute 18

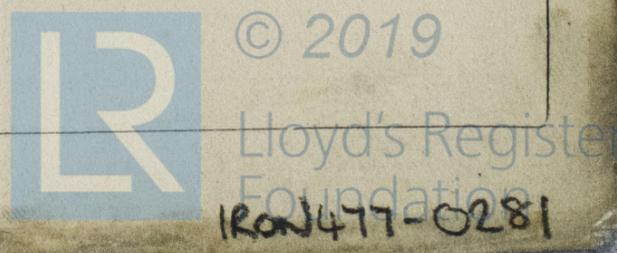

This vessel-machinery has been
repaired but it not fitted in
accordance with the rules,
submitted that she is eligible
to remain as closed

M 29.4.78



© 2019

Lloyd's Register
Foundation