

Report of Survey for Repairs of Engines and Boilers.

No. 80.

No. in
Reg. Book.

Survey held at

Cardiff

Date, first Survey

7th June

Last Survey

11th June

1879

581

on the

Iron

Screw

Steamer

Landedarne

Master

Boase

Built at

Newcastle

When built

1877

Tons

1048
673

Owners

C. E. Hallybairs & Co

Port belonging to

Cardiff

Classed

Lloyd's M.C. 777

Years
assigned

Character in Register Book.

100 A1
777

YEAR.

Diameter of Cylinder

28" & 53"

Length of Stroke

36"

Engines made at

Hull

When made

1877

Pressure of Steam

65# per sq. inch.

By whom made

Amor & Smith

Registered Horse Power

110

Particulars of Repairs and Examination

On account of damage sustained through grounding in the river Scarries on the voyage from Torrecarrah to Roney Bay on the 5th of April 1879 now done: The ship placed on the Gridiron and propeller and sea connections found in good condition. The bottom chafed slightly, but no damage could be observed. The bottom cleaned and recoated. New pump rod fitted to circulating pump, also new plunger with brass liner and stud to feed pump, new foot valve guard to circulating pump and new pedestal for lever gudgeon. The crosshead of circulating pump and one lever spring straightened. The Machinery is now in good order and safe working condition, and in my opinion can remain as classed.

The Amount of Fee ... £ 2 : 2 :

received by me,

Certificate (if required) ... £ :


12th June 1879

(Travelling Expenses, if any, £)

Committee's Minute

18

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

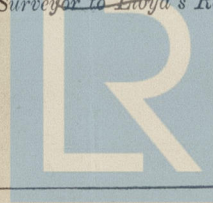

Lloyd's Register
Foundation

IRON 485-0291

This vessel's machinery was examined to ascertain if any damage had been sustained from grounding. It is reported in good condition, and the vessel is submitted as being eligible to remain as classed.

ND 16-6-79

5
H. Hamelane

© 2019

Lloyd's Register
Foundation