

23806

Report of Survey for Repairs of Engines and Boilers.

No.

Rev 26.5.79

No. in
Reg. Book.

Survey held at

London

Date, first Survey

Last Survey 22nd May 1879

150

on the

S.S. Nerissa

Master

Built at

Newcastle

When built

1877

Tons

1299
2000

Owners

J. Fawcett & Co

Port belonging to

London

Classed

Years
assigned.

Character in Register Book.

100A1
S.S. Nerissa 11.77

Diameter of Cylinder

33 & 1/2

Length of Stroke

42

Engines made at

Newcastle

When made

1877

Pressure of Steam

80 lbs

Registered Horse Power

260

By whom made

Palmer & Co

Particulars of Repairs and Examination

On examination by the owner

representative the forward crank pin was found slightly flawed, the shaft was taken out and a wrought iron pin 4 1/2 inches diameter has been fitted through it, shaft replaced and refitted to bearings.

In my opinion this repair is thoroughly satisfactory and the vessel is eligible to retain her class in the Register Book.

(Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.)

 The Amount of Fee ... £ - : - : received by me, }
 Certificate (if required) ... £ : : 187 }

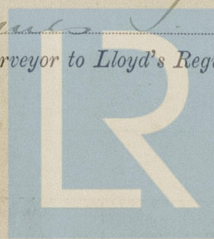
(Travelling Expenses, if any, £

No action

Committee's Minute

to go away

18

 James L. Buffin
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

 Lloyd's Register
 Foundation

806



© 2019

Lloyd's Register
Foundation