

23919

Report of Survey for Repairs of Engines and Boilers.

No. 106
No. in Reg. Book. 353 Survey held at Bull Date, first Survey 7th June Last Survey 26th June 1879
on the Ironscrew Steamer "Albanian" Master Cameron
Built at Port Glasgow When built 1855
Tons 1011 Owners Brown, Atkinson & Co Port belonging to Bull Classed 90 A 1
1340 1165 Years assigned. Character in Register Book. 9. 78

Diameter of Cylinder 27" x 53" Engines Comp made at Bull When made 1876
Length of Stroke 36" By whom made Holmes & Co.
Pressure of Steam 100 lbs per sq. in.
Registered Horse Power 95 HP


Particulars of Repairs and Examination of Machinery "in consequence of damage said to have been sustained by the vessel having grounded"

The Condenser tubes drawn. all pumps sea cocks & valves opened up. the whole thoroughly cleared & cleaned. and the pipes connected with same all examined & cleared. Shafting uncoupled & examined. Bearing on outer stern post lined up. Substies to piston rod guides & the guide bars planed up. on "reversing" side. Water service pipes taken off, cleared and repaired. Condenser tubes replaced & all put in good working order. On deck. the forward steam winch and Crane repaired & put in good order. Is eligible, in my opinion to remain as classed.

The Amount of Fee £ 3 : 3 : - received by me, John B. Stevens
Certificate (if required) £ - : - : - 17th July 1879
(Travelling Expenses, if any, £)

Committee's Minute 18

John B. Stevens
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

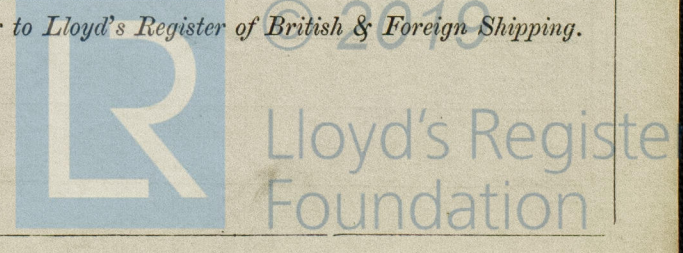

The machinery of this vessel has been
repaired in consequence of damage sustained
by vessel having grounded it is
reported to be in good working
order submitted that she is
eligible to remain as cleared
and have a new certificate
from 26 June 1879 also
note of 12 ps in the
Register book

M
21.7.79

