

Survey Report. 25538. Iran
on the British steamer "Celestial"
Captain A. J. White.

I the undersigned surveyor do hereby certify that I have this day proceeded onboard the above named vessel now in dry dock at Tanjong Pagar and after a careful examination report as follows Found the Shell plates through which 3 of the sea cocks pass very much honey combed. Ordered a circular piece to be cut out and a new piece fitted in and a linen fitted inside to act as a bull strap. The pintles of the rudder are very much worn, recommend ferrules to be shrunk on. Inside the ship in the fore hold some of the ceiling is rotten this must be renewed and 2 spaces between the frames, the cement to be chipped out and re-cemented. In the after hold the stone ballast must be taken out and the ceiling lifted that the cement may be examined.

Singapore

16th January 1879

Chas. Pittcock

Surveyor to Lloyds Register


I have again visited the vessel and find the cement in the after hold, Engine and Boiler room good, I recommend new ceiling to be laid in the after hold.

When all the above recommendations are completed the bottom to be well coated with paint.

17th January 1879.

Chas. Pittcock

Surveyor to Lloyds Register

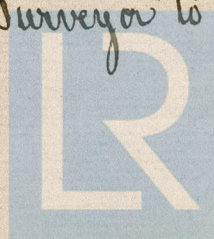

Lloyd's Register
Foundation