

# Report of Survey for Repairs of Engines and Boilers.

(Received at London Office, 14/6/80)

312

Survey held at *South Shields* Date, first Survey 20<sup>th</sup> May Last Survey 1<sup>st</sup> June 1880

on the Machinery of the *Screw Steamer "Rouen"* (Number of Visits *four*)

Displacement, Gross <i>757</i>	Built at <i>Sunderland</i>	When built <i>1876</i>
Ditto, Net <i>481</i>	Owners <i>Adam Bros &amp; Co.</i>	Port belonging to <i>1876</i>
Diameter of Cylinder <i>26" &amp; 47"</i>	Engines made by <i>P &amp; W Hawthorn</i>	When made <i>1876</i>
Length of Stroke <i>36"</i>	Boilers made by <i>Do</i>	When made <i>1876</i>
Pressure of Steam <i>70 lbs</i>	If Surveyed Afloat or in Dry Dock <i>Both</i>	Classed <i>90 A1</i>
Registered Horse Power <i>95</i>		Character in Register Book <i>3.80</i>

Last Survey No. Port

Particulars of Repairs and Examination *The Machinery of this vessel has been examined for Special Survey 70%.*  
*Cylinders and valves examined and found satisfactory.*  
*Cranks shaft examined and found satisfactory.*  
*Tunnel shafting examined. brass rings for thrust collar worn recommended them to be renewed.*  
*Pumps drawn for examination and found satisfactory.*  
*Condenser tubes to be drawn and cleaned. & condenser sludged from sand and grit.*  
*Boilers examined internally and externally and found in fair condition. drilled furnaces and combustion chambers recommended portion of C chamber in wing of front furnace to be cut out and patch riveted. otherwise satisfactory. Safety valve examined. Satisfactory.*  
*Donkey boiler examined in good condition. Safety valve loaded to 44 lbs.*  
*Examined sea cocks. Stern bush. propeller shaft & propeller stem bush to be relined with lignum vitae. the others satisfactory.*  
*The above examination and repairs being now satisfactorily completed*


General Observations, Opinion, and Recommendation: *The Machinery of this vessel is now in good order and safe working condition and eligible in my opinion to Retain her class in the Society's Register book*

Entry or Registering Fee ... £ - : - :  
 Survey Fee ... £ 4 : 4 : - received by me, *W. G. S.*  
 Certificate (if required) ... £ - : - : - 10<sup>th</sup> June 1880  
 (Travelling Expenses, if any, £ -)

*John Brockat*  
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute *Tuesday, June, 15<sup>th</sup> 1880.*

Assigned

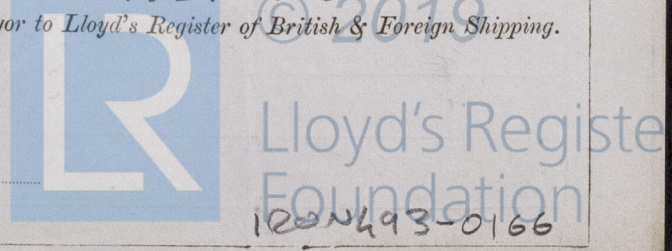

(Insert Character precisely as in the Register Book.)



It is submitted that this  
vessel is eligible to have  
the notification  
Lloyd's M.C. 6.80  
recorded in the  
Register Book.

M  
14/6/80



© 2019

Lloyd's Register  
Foundation