

Report of Survey for Repairs of Engines and Boilers.

2695/Gen

No. _____ (Received at London Office, 22. 6. 80)

No. in Reg. Book. Survey held at London Date, first Survey June 11th Last Survey June 17th 1880

171 on the Machinery of the S. S. "Malaga" (Number of Visits 4)

Tonnage, Gross <u>1614</u>	Built at <u>W. Hartlepool.</u>	When built <u>1876</u>
Ditto, Net <u>1024</u>	Owners <u>J. Hall Jnr. & Co.</u>	Port belonging to <u>London</u>
Diameter of Cylinder <u>32" + 60"</u>	Engines made by <u>Blair & Co.</u>	When made <u>1876</u>
Length of Stroke <u>39"</u>	Boilers made by <u>Blair & Co.</u>	When made <u>1876</u>
Pressure of Steam <u>80</u>	If Surveyed Afloat or in Dry Dock <u>Dry dock & Afloat</u>	Classed <u>100A1</u>
Registered Horse Power <u>140</u>		Years assigned. Character in Register Book.
Last Survey No. _____	Port _____	<u>Lloyds M.C. 6.76.</u>

Particulars of Repairs and Examination According to the requirements for Special Survey No 1. —

Examined crank shaft which was found to be in good condition. Boilers examined, combustion chambers & tube plates free from patches, furnaces in good condition, shell of Boiler in good condition, no signs of any leak being visible. Safety Valves examined and found in good condition. Cylinders examined and found to be in good condition. Slide valves examined in good condition, a slight crack found in upper bar of cylinder face of Low pressure cylinder which has stays fitted in steam passage. Air and Circulating pumps examined and found to be in good condition. —

Vessel placed in dry dock sea cocks examined and overhauled, propeller examined and found to be in good condition, new lignum vitae bush fitted, tail shaft examined and found in good condition.


General Observations, Opinion, and Recommendation: — The Engines & Boilers of this ship being now in good and safe working condition are eligible, in my opinion, to be marked in the Register Book with Lloyds M.C. 6.80.

Entry or Registering Fee 24/6 £ 1 : : :
 Survey Fee ... £ 3 : 3 : : received by me,
 Certificate (if required) ... £ : 26 26 June 1880
 Dwellling Expenses, if any, £ _____

Geo. E. Merriam
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute _____

Assigned _____

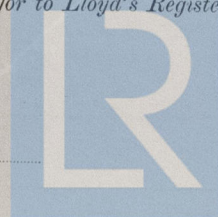

Lloyd's Register
 Foundation
 (201403-0280)

It is submitted that
this vessel is eligible
to have the notations
Lloyd's No. 6. 80
recorded in the
Register Book

M.
21/6/80



© 2019

Lloyd's Register
Foundation