

Report of Survey for Repairs of Engines and Boilers.

(Received at London Office, 15/12/80)

27309
in Survey held at Birkenhead Date, first Survey 1st Decr Last Survey 4th Decr 1880
Book. S.S. "Kingston" (Number of Visits 2)
on the Machinery of the S.S. "Kingston" Year
Age, Gross 1449 Built at Sunderland When built 1871-2 mo
Net 922 Owners Commercial S.S. Coy (limited) Port belonging to London
Diameter of Cylinder 1 of 29 1/2" 1 of 58 1/2" Engines made by N & Marine Coy When made 1871
Length of Stroke 33 Boilers made by -do- -do- When made 1878
Pressure of Steam 75 If Surveyed Afloat or in Dry Dock Dry dock Classed 90A1
Registered Horse Power 130 Character in Register Book. Lloyd's M.C. 7-78
Last Survey No. Port


Particulars of Repairs and Examination Through damage caused by striking
floating wreck and fire in holds &c
Propeller removed and refitted with a new feather and washer
Sea cocks overhauled and 2 new plugs fitted to bottom blow off cocks
Steam pipe removed repaired and refitted. Thrustle valve overhauled
Guide plates and shoes removed lined and refitted. Smoke engine
repaired. Lubricating pump valves repaired. Branch pipes removed
repaired and refitted.

General Observations, Opinion, and Recommendation:— The machinery and Boilers
of this vessel so far as seen at this time are in a good and
efficient condition and in my opinion entitle the vessel to return
the Notification Lloyd's M.C. 7-78.

Entry or Registering Fee 2 - 2 -
Damage Survey Fee 1 - 1 -
Survey Fee ... received by me, J. F. L.
Certificate (if required) ... 1880

(Travelling Expenses, if any, £ ...)
Committee's Minute Liverpool Dec^r 14, 1880
Assigned 90A1. Record & rep.

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

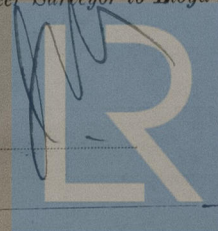

© 2019

Lloyd's Register Foundation

TRON 47-0378

Kingston

ss

27309

This submitted sheet this
vessel is eligible to
remain as classed

JM

15/10/82



© 2019

Lloyd's Register
Foundation