

REPORT of SURVEY for REPAIRS.

10, 4/2

No. 32 Survey held at London Date Feb 26 to Mar 5 1844
 on the B^k Achilles Master ~~W. H. H. H.~~ H. Nicholas
 Tonnage 196 Built at London When built 1826
 By whom built _____ Owners Salter & Co
 Port belonging to London Destined Voyage Guiana
 If Surveyed Afloat or in Dry Dock Lincolin Dock

Last Survey, No. 1036 1834 Classed 12 A expunged

Port London

REPAIRS At the present time - The doubling carried down two
 stakes lower - Making in all seven stakes & affixing
 new plank sheers and birthing round bow forward
 and fore hoods of sheer stakes shifted - Being caulked
 from the keel up - Resheathed with yellow stetab
 on hemp felt - Gunse Boxes, & Head Rails down
 and refitted - One new Pintle to Rudder - New
 Main Mast & Bowsprit

MS. The Doubling upon the vessel was put out to increase
 her stability - and is along the side from the Main chains forward
 from the Main chains aft the Quarter is sheathed at the present
 time - &c

Present Condition of the

Decks	Transoms	Windlass
Upper Deck Beams & Fastenings	Timbers of the Frame	Capstan
Lower Deck Beams & Fastenings	Topsides	Pumps
Spirkettling	Wales	Masts, Yards, &c.
Plank Shears	Counter	Sails
Waterways	Plank & Treenails (Outside to the Water's Edge)	Cables
Hatchway Comings	Rudder	Anchors No. of
Breasthooks	Copper	Standing & Running Rigging


General Observations and Opinion,

In my opinion the vessel is fit for the conveyance
 of dry and perishable cargoes to and from all parts of
 the world & is eligible to the Class A. 1

The Amount of Fee £ 1 - 0 - 0 is received by me,

Committee's Minute 15th March 1844

Character assigned A. 1

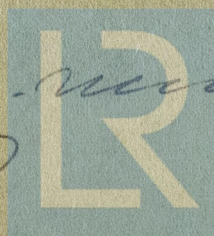

© 2019
 Lloyd's Register
 Foundation

The Surveys to report when
the Bottom was last examined

or

15 March

The sheathing reports to be put

at 1830 - is not now on

G.B.



© 2019

Lloyd's Register
Foundation