

REPORT of SURVEY for REPAIRS.

16297

No. 372 Survey held at Soudon Date 23rd Aug 1850
 on the Bark "Mary" Master Grant
 Tonnage 443 Built at Sunderland When built 1842
 By whom built _____ Owners Boulcott
 Port belonging to Soudon Destined Voyage Bombay
 If Surveyed Afloat or in Dry Dock in Messrs Green's Dock

Last Survey, No. 14526 Port Soudon Classed GA 1

REPAIRS

at present from damage. Keel & flat of bottom
 stripped. Rung in shores. Rudder bands refastened
 and butt-warks repaired.

And not from damage the rest of the yellow
 metal sheathing stripped off and all the
 bottom caulked four after hoods of bottom on
 the larboard quarter removed and a new half
 transom fitted to wing transom & flukes and transom
 knee replaced. One new upper deck beam
 and several others added and an entirely
 new upper deck laid of Antyic yellow metal.

Present Condition of the	New upper deck	Treenails	Good	Windlass and Capstan	
Decks	Good	Breasthooks and Stemson		Pumps	
Waterways		Transoms, Pointers, and Crutches		Boats	
Comings		Timbers of the Frame		Masts, Yards, &c.	Good
Upper Deck Beams & Fastenings		Keelsons		Sails	
Lower Deck Beams & Fastenings		Clamp and Shelves		Anchors No. of	Sufficient
Planksheers		Ceiling		Cables	
Sheerstrakes		Rudder bands refastened		Hawsers and Warps	
Topsides		Copper	Ym When put on New	Standing & Running Rigging	
Vales	Caulked		Sep. 1850		
Plank (Bottom) and Counter					

General Observations and Opinion,

This Vessel is now in efficient Condition
 and may remain as classed

The Amount of Fee.....£ 2 : : is received by me,


Special..... 4 : 4 : -

Certificate (if required) : :

Committee's Minute 20th Sept. 1850

Character assigned

GA 1 Good
 Special Damage £4. 4. 7

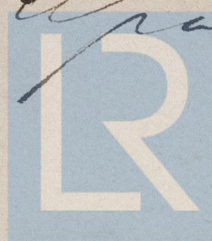

© 2019

Lloyd's Register
 Foundation

LON 629-0146