

REPORT of SURVEY for REPAIRS.

Change of Owners

10448

No. 02 Survey held at London Date 8th 15 Nov. 1859
 on the B^{re} Lady Sale Master Thos Jackson Junr
 Tonnage 346 388 Built at Newcastle When built 1843
 By whom built _____ Owners Thos Jackson
 Port belonging to Whitby Destined Voyage Sydney
 If Surveyed Afloat or in Dry Dock in Smeeths Dock

Last Survey, No. 13788 Port Newcastle Classed G A 1

REPAIRS

at present bottom stripped Caulked from the Keel to the waterways and the bottom resheathed with yellow metal on felt three short planks shifted on the starboard quarter being worn also one plank & one forehook of topsides new ~~timbers~~ boards ~~boards~~ boards & go on one head chock down & refitted - Rudder trunk repaired New Bonnet new fore yard & topmast Hull, Masts & Rigging generally overhauled & refitted

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons	Sails
Planksheers	Clamps and Shelves	Anchors No. of
Sheerstrakes	Ceiling	Cables
Topsides	Rudder	Hawsers and Warps
Wales	Copper	Standing & Running Rigging
Plank (Bottom) and Counter	When put on	

Good *Good* *Good* *Sufficient* *new copper & red* *good* *2 stunts* *3 1 1* *Sufficient* *11 50*

General Observations and Opinion,

This vessel is in efficient Condition and may remain as Classed


The Amount of Fee.....£ 2 : - : is received by me,

Special.....

Certificate (if required) : 10 : -

Committee's Minute 20th Nov. 1859

Character assigned

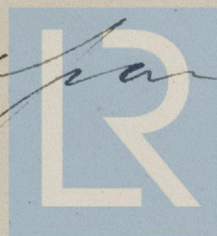

© 2019

Lloyd's Register Foundation
LON 629-0306