

REPORT of SURVEY for REPAIRS.

No. 213 on the Black River Packet Master E. Stamp
 Survey held at London Date Jan 22 to Feb 21 1851
 Tonnage 265 Built at Southampton When built 1825
 By whom built _____ Owners Morrice & Co
 Port belonging to London Destined Voyage Jamaica
 If Surveyed Afloat or in Dry Dock In King and Queen Dry Dock

Last Survey, No. 10430 Port London Classed 10 A 1
 Rest 43.7 Cont 50.2 7mo 50

REPAIRS

At the present ^{time} of damage sustained by stress of weather in her passage from Jamaica. The four upper Stakes of Yellow Metal Sheathing stripped off and renewed upon Paper. Caulked from thence upwards — including the Deck, part of Hold Beam Hanging Knee Bolts renewed, fourteen Roughtree Stantions new, Bulwarks nearly all new, Main Mast new, Fore Mast repaired, Boats new and Sundry Stows. More of particulars in Special Report.

Not of accident. The whole of Apron new of English Oak, and Mahogany Hold Beam Hook, and one lower Breast Hook new of Asiatic Oak, Foremost Piece of Main Keelson new of African Oak, one new Hold Beam and one half of another African Oak, the Hold Ceiling wholly dubbed over and repaired where necessary, Gripe off and refitted.

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways } <u>Good</u>	Breasthooks and Stenson } <u>Good where seen</u>	Pumps
Comings } <u>Good where seen</u>	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c. <u>In good order</u>
Lower Deck Beams & Fastenings	Keelsons <u>d^o</u>	Main Mast new <u>and sufficient</u>
Planksheers	Clamps and Shelves <u>d^o</u>	Sails
Sheerstrikes <u>d^o</u>	Ceiling <u>d^o</u>	Anchors No. of
Topsides <u>d^o</u>	Rudder <u>d^o</u>	Cables
Wales <u>d^o</u>	Copper <u>Y Metal</u> When put on <u>part 1840 part now new</u>	Hawsers and Warps
Plank (Bottom) and Counter <u>d^o</u>		Standing & Running Rigging

General Observations and Opinion.

This Barque is now in good condition eligible to remain as Classed A 1

The Amount of Fee.....£ 1 : — : — is received by me,


Special..... 3 : 3 : 4

Certificate (if required) _____

Committee's Minute

Character assigned

Special Repair £3-3-0
 or damage

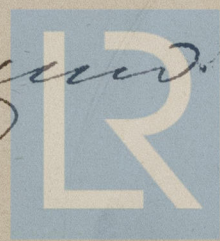

© 2019

Lloyd's Register Foundation

LON 629-0444