

REPORT of SURVEY for REPAIRS.

16869

No. 532 on the *B^{re} "Columbus"* Master *a Notton* Date *31 May 1857*
 Tonnage *467* Built at *Whitby* When built *1837*
 By whom built _____ Owners *J. Fletcher*
 Port belonging to *London* Destined Voyage *New Zealand*
 If Surveyed Afloat or in Dry Dock *in Mess^r Fletcher's Dock*

Last Survey, No. *13927* Port *London* // Classed *A. 1* SS. *47*

REPAIRS at present a *Strake* (Channel Rail Moulding) taken out on both sides, and the timbers of the frame exposed which were found good with the exception of a few ⁽⁴⁾ on the larboard bow which have been turned and the Sheerstrakes, top-sides, and wales, and one Strake under the wales doubled, on felt the Strake next under the wales was let in home to the timber which were found sound there also — the doubling is chiefly of 2¹/₂" Teak and oak the top-sides are doubled with 2" Cove — doubling braced & thro' bolted every 6 ft with Yellow Metal & Lower

Present Condition of the

Decks	<i>Caulked Good</i>	Treenails	<i>Good</i>	Windlass and Capstan	<i>Good</i>
Waterways	<i>Do</i>	Breasthooks and Stemson	<i>—</i>	Pumps	<i>—</i>
Comings	<i>Do</i>	Transoms, Pointers, and Crutches	<i>—</i>	Boats	<i>—</i>
Upper Deck Beams & Fastenings	<i>in 4 out bolts new good</i>	Timbers of the Frame	<i>—</i>	Masts, Yards, &c.	<i>Sufficient</i>
Lower Deck Beams & Fastenings	<i>Lower Shelf Metal bolts good</i>	Keelsons	<i>—</i>	Sails	<i>Do</i>
Planksheers	<i>Good</i>	Clamps and Shells	<i>—</i>	Anchors No. of	<i>Do</i>
Sheerstrakes	<i>doubled 2¹/₂" Teak</i>	Ceiling	<i>—</i>	Cables	<i>Do</i>
Topsides	<i>doubled 2" Cove</i>	Rudder	<i>—</i>	Hawsers and Warps	<i>Do</i>
Wales	<i>doubled 2¹/₂" Teak</i>	Copper	<i>Ym</i> When put on <i>1850</i>	Standing & Running Rigging	<i>Do</i>
Plank (Bottom) and Counter	<i>Good</i>				

General Observations and Opinion,

This Vessel is in efficient Condition and in our opinion fit for the safe conveyance of dry perishable Cargoes to & from all

The Amount of Fee.....£ 2 : : is received by me,

Special..... 2 : 2 : —


Certificate (if required) : 10 : —

Committee's Minute

Character assigned

Special £2. 2 —

LON 630-0253

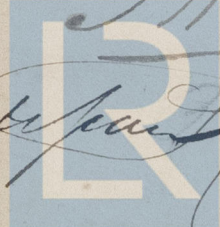

Lloyd's Register Foundation

16869 Jan.

all the bolts of hanging & loding ^{stanchions} renewed
tho¹st doubling - all new chain bolts driven
toop drifts all renewed of Red & yellow pine
new figure & fitting to the head, hauser jipes
refitted, decks Caulked, Hull, Mast, & rigg
generally overhauled and refitted -

A. H. H. H.
Fountainay



© 2019

Lloyd's Register
Foundation