

17172

# REPORT of SURVEY for REPAIRS.

No. 12 Survey held at London Date Oct 27 to Nov 12 1851  
on the Bk Parrock Hall Master G. Moffatt  
Tonnage 345 Built at Yarmouth When built 1837  
By whom built 43 1/2 Owners Boddington  
Port belonging to London Destined Voyage St Kitts  
If Surveyed Afloat or in Dry Dock Afloat & Yongs Dock

Survey, No. 13801 Port London Continued 1849 Classed 12 4 A 1

PAIRS At the present time new wing transom of African Oak all the after hoods of the wales ~~on both sides~~ two after shifts of the black shakes, & three of the bottom all to their original shifts on both sides, new buck rail & Iron straps from the stern timbers to the wing transom & the after body caulked.

## Present Condition of the

Decks	Treenails <u>good</u>	Windlass and Capstan <u>good</u>
Waterways	Breasthooks and Stemson <u>Do</u>	Pumps <u>Do</u>
Comings	Transoms, Pointers, and Crutches <u>Do</u>	Boats <u>Do</u>
Upper Deck Beams & Fastenings	Timbers of the Frame <u>good wherever exposed</u>	Masts, Yards, &c. <u>Do</u>
Lower Deck Beams & Fastenings	Keelsons <u>good</u>	Sails <u>well found</u>
Planksheers <u>Good</u>	Clamps and Shelves <u>Do</u>	Anchors No. of <u>3 Bowers Stem &amp; Kedge</u>
Sheerstrakes	Ceiling <u>Do</u>	Cables <u>well found</u>
Topsides	Rudder <u>Do</u>	Hawsers and Warps <u>Do</u>
Wales	Copper <u>Y.M.</u> When put on <u>1849</u>	Standing & Running Rigging <u>good</u>
Plank (Bottom) and Counter		
General Observations and Opinion	<u>Is in a very good &amp; efficient state &amp; in all respects fit to retain her present class</u>	


The Amount of Fee.....£ 2 : : is received by me, A. M. Wilson

Special..... : :

Certificate (if required) : :

Committee's Minute 21<sup>st</sup> Nov 1851

Character assigned Class 4

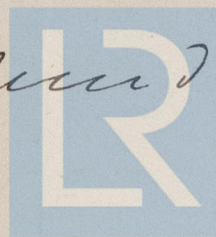

© 2019

Lloyd's Register Foundation

LON681-0127