

21860

REPORT of SURVEY for REPAIRS.

No. 68 Survey held at London Date June 14 to 25 1859  
on the Ship Eastern Monarch Master H Morris  
Tonnage 1631 Built at Dundee When built 1856  
By whom built Stephens & Co Owners James B  
Port belonging to London Destined Voyage East India  
If Surveyed Afloat or in Dry Dock In Mess James by Jock afloat in E India Dock

Recd 23.7.59  
C.R.

Last Survey, No. 2379 Port Dundee Classed 14 A 1  
56

REPAIRS at the present time of damages sustained by  
"striking the ground heavily" on leaving Dundee  
for India, likewise in the Persian Gulf, while in  
tow of a Steamer. For particulars see Special Report.

Yellow Metal Sheathing stripped off and renewed upon  
Pill aloft, and Paper below. Ship hung in thous, the aftmost  
and the Foremast pieces of False Keel replaced, and the ship  
caulked from keel upwards to Seam of <sup>upper</sup> Deck next the  
Waterway.

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons	Sails
Planksheers	Clamps and Shelves	Anchors No. of
Sheerstrakes	Ceiling	Cables
Topsides	Rudder	Hawsers and Warps
Wales	Copper	Standing & Running Rigging
Plank (Bottom) and Counter	When put on <u>now new</u>	
General Observations and Opinion,	Caulking of Bottom, Deck, & Waterways. <u>good where tried</u>	

This Ship now appears to be in good condition,  
eligible to remain as Classed A 1


The Amount of Fee.....£ : : is received by me,  
Special..... : :  
Certificate (if required) : :

Committee's Minute 13<sup>th</sup> July 1858  
Character assigned 14/1

J. D. Martin  
W. T. Sturges  
Will<sup>m</sup> C. Davy

Special Survey  
and Report on Damage  
No Repair Fee

record  
G.M.P.  
L.R.

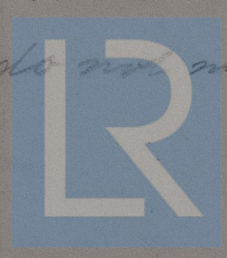

Lloyd's Register  
Foundation  
LN640-0060