

23539

REPORT of SURVEY for REPAIRS.

No. ²⁶ on the 13th "Palm" Survey held at London Date 27th Oct^r to Nov^r 1860
 Master Legget
 Tonnage 268 Built at Sunderland When built 1849
 By whom built _____ Owners Lanaway
 Port belonging to London Destined Voyage Antigua
 If Surveyed Afloat or in Dry Dock Gravesend & West India dock

Last Survey, No. 23432 Port London Classed 10 D
 Cont 59 3 9

REPAIRS

Through damage sustained by collision for full particulars see Special Report thereon

Upper piece of Stem new of E I Teate, one plank of Wales on the 4th side of Pitch Pine and two pieces, 2 wood knees to upper deck Beams on the Port side forward taken out and replaced with Iron ones, several started Greenails on both bows renewed, one piece of main Bulwark Rail on the Star bow new & part new Bulwarks, recast from after part of fore dipping forward and from Yellow Metal line over all, - new Lubbock &c. Cutwater not at present replaced or renewed. (the old one entirely carried away) to be so on her return from her present voyage.

Present Condition of the

Decks		Treenails		Windlass and Capstan	
Waterways		Breasthooks and Stemson		Pumps	
Comings		Transoms, Pointers, and Crutches		Boats	
Upper Deck Beams & Fastenings		Timbers of the Frame		Masts, Yards, &c.	
Lower Deck Beams & Fastenings		Keelsons		Sails	
Planksheers		Clamps and Shelves		Anchors No. of	
Sheerstrakes		Ceiling		Cables	
Topsides		Rudder		Hawsers and Warps	
Wales		Copper Sheen		Standing & Running Rigging	
Plank (Bottom) and Counter		When put on			

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good where tested

This vessel is now in good condition and in my opinion eligible to continue as classed A1

The Amount of Fee.....£ — : 10 : — is received by me,


Special. at... } 3 : 3 : —

Certificate (if required) : 5 : —

Committee's Minute 20th November 1860

Character assigned Cont 3 D 1

record in map repair

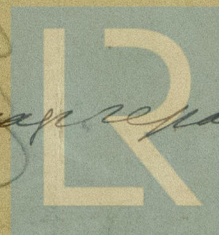

© 2019

Lloyd's Register Foundation

LON 643-0304