

# REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 426 Survey held at London Date 8<sup>th</sup> May June 3<sup>rd</sup> 1867  
 on the Ship Shannon Master George Hill  
 Tonnage 732 825 Built at Sunderland When built 1853  
 By whom built — Owners Blyths & Greene  
 Port belonging to London Destined Voyage Mauritius  
 If Surveyed Afloat or in Dry Dock "Britannia" dry dock & West India Dock

Last Survey, No. 26272 Port London Classed Cons<sup>g</sup>/63. Y. A. I.  
 64

## REPAIRS

Stripped off the yellow metal sheathing. Cut out some slight defects from the wales (Starb<sup>d</sup> side), and a piece from the fore end of keel. unbolted the Comings and Head ledges to main hatchway, and enlarged it. Cut one of the hold beams, and made it as others to ship, and unship for the convenience of stowage. — Introduced new Comings, Head ledges, Carlings, hatches &c to main hatchway. — Lifted the masts gave her a new Foremast, and fished the main; also the mizen mast, new tops to masts New fore yard, and double fore topsail yards.

Repaired and refitted the rigging. New Cashead on the Starb<sup>d</sup> side. — Examined the windlafs. Stripped off the linings. the main piece is sound. — Lifted limber boards, examined as far as practicable, floors, timbers &c at the openings. —

Caulked up to copper line, and some of the butts in the topsides. — Resheathed with yellow metal on felt. —

## Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways <u>in good order</u>	<u>where seen good</u>	<u>in good order</u>
Comings <u>"</u>	Breasthooks and Stemson <u>"</u>	Pumps <u>"</u>
Upper Deck Beams & Fastenings <u>firm</u>	Transoms, Pointers, and Crutches <u>"</u>	Boats <u>"</u>
Lower Deck Beams & Fastenings <u>"</u>	Timbers of the Frame at the openings <u>"</u>	Masts, Yards, &c. <u>part new.</u>
Planksheers <u>"</u>	Ditto Ditto at other places <u>"</u>	Condition, how ascertained <u>from the Deck</u>
Sheerstrakes <u>"</u>	Keelsons <u>"</u>	Sails <u>"</u>
Topsides <u>"</u>	Clamps and Shelves <u>"</u>	Anchors No. of <u>3</u>
Wales <u>"</u>	Ceiling <u>"</u>	Cables <u>"</u>
Plank (Bottom) and Counter <u>"</u>	Rudder <u>efficient</u>	Hawsers and Warps <u>"</u>
	Copper <u>Hy-met</u> When put on <u>now</u>	Standing & Running Rigging <u>"</u>

## General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. where tested good.


This vessel being in good condition. Sam of opinion she is entitled to remain as classed Y. A. I.

Samuel Presons

The Amount of Fee.....£ — : — : } is received by me.  
 Special..... 2 : 2 : }  
 Certificate (if required) — : — : }

Committee's Minute 11<sup>th</sup> June 18 67

Character assigned Cont<sup>d</sup> 7<sup>th</sup> A

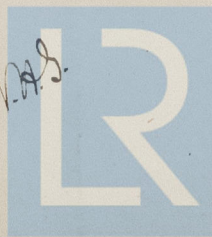

© 2021

Lloyd's Register Foundation

LON652-0092