

# Half time Survey

## REPORT of SURVEY for REPAIRS.

28349

No. in Reg. Book. **No.** 12 Survey held at London Date June 1<sup>st</sup> 6 3<sup>rd</sup> 1867.  
 on the "Bk" Balcombe" Master Wm Storey  
 Tonnage 359 Built at Sunderland When built 1861 (7 mo.)  
 By whom built Austin Owners J Hankey  
 Port belonging to London Destined Voyage Genoa  
 If Surveyed Afloat or in Dry Dock Nelson dry Dock,

Last Survey, No. 27015 Port London Classed O.A.1 (9.65.)  
 REPAIRS None done.

Sighted bottom, the Yellow metal stripped, the hold cleared, except at the bilges, the timber boards lifted, and air courses cleared, also one cut at each end of the hold on both sides between the keelson and the hold beam clamps; the outside planking scraped bright at various places on each side, and a few treenails drifted out; the Windlass stripped, and Chains ranged, and all other requirements of the Rule strictly attended to.

Caulked from keel to metal line, and resheathed the bottom with yellow metal on felt.

The Owners of this Ship being urgently pressed for time, could not remove the Ballast from the Hold, but propose submitting the bilges for examination on the completion of the present voyage, that being the only part not seen.

### Present Condition of the

Decks	<div><div>Good</div><div>where</div><div>seen</div></div>	Treenails	<div><div>Good</div><div>where</div><div>seen</div></div>	Windlass <del>and Capstan</del> <i>Stripped</i>	<div><div>Good</div><div>and</div><div>Sufficient</div><div>where</div><div>seen</div></div>
Waterways		Breasthooks and Stemson		Pumps	
Comings		Transoms, Pointers, and Crutches		Boats <i>2</i>	
Upper Deck Beams & Fastenings		Timbers of the Frame at the openings		Masts, Yards, &c. <i>Good</i>	
Lower Deck Beams & Fastenings		Ditto Ditto at other places		Condition, how ascertained <i>insp<sup>n</sup> and enquiry</i>	
Planksheers		Keelsons		Sails	
Sheerstrakes		Clamps and Shelves		Anchors No. <i>or 3 B. 15. 1/2</i>	
Topsides		Ceiling <i>greater part seen</i>		Cables <i>240 fath = 1 7/16</i>	
Wales		Rudder <i>Ad good</i>		Hawsers and Warps	
Plank (Bottom) and Counter		Copper <i>Mon L</i> When put on <i>now</i>		Standing & Running Rigging	
General Observations and Opinion,		Caulking of Bottom, Deck, & Waterways. <i>Good where tested</i>			

She is now in good and efficient condition, and has been examined in accordance with the Half time Survey, except at the bilges, we therefore respectfully recommend her under the above circumstances to the favourable consideration of the

The Amount of Fee.....£ : : is received by me,

Special.....2.2.0


Certificate (if required) : : :

Committee's Minute 14 June 1867

Character assigned 10 B  
*recd Y M H.T. 67*

Committee  
 Joseph Kew.

*Thos. W. Brown*

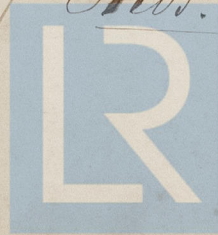

Lloyd's Register  
 Foundation

LON652-0099