

28456

REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 76 Survey held at London Date 6th April to 3rd May 1867.
on the Ship "Saladin" Master J Rankin
Tonnage 782 Built at Sunderland When built 1851.
By whom built _____ Owners Henderson
Port belonging to London Destined Voyage Colombo
If Surveyed Afloat or in Dry Dock Princes dock Dock and West India Docks.

Last Survey, No. 2724-5 Port London Classed B. A. 1 (Cont 64 9th)
REPAIRS Now done. 66

Sighted bottom, the yellow metal stripped; peaks cleared and limbers lifted; Repaired the keel to Head, and renewed the whole of the Head Rails, with Italian-oak;

Fitted new Patent Pumps; and Caulked from Keel to the second Seam of deck; the butts of the bottom, also keel seam, and fore and after hood ends, are now felted and lead luted, and bottom resheathed with yellow metal on felt

Renewed the jibboom, Main-topmast, Main-topgallantmast and Mizen topgallantmast with Red pine and battie spars.

Present Condition of the

Decks		Treenails		Windlass and Capstan	
Waterways		Breasthooks and Stemson		Pumps <u>2 Main, 2 Bilge</u>	
Comings		Transoms, Pointers, and Crutches	<u>Good</u>	Boats <u>4</u>	
Upper Deck Beams & Fastenings	<u>Good</u>	Timbers of the Frame at the openings	<u>Good</u>	Masts, Yards, &c. <u>Good</u>	
Lower Deck Beams & Fastenings	<u>where</u>	Ditto Ditto at other places	<u>where</u>	Condition, how ascertained <u>insp^d</u>	
Planksheers <u>caulked</u>		Keelsons		Sails	<u>Good and sufficient</u>
Sheerstrakes <u>do</u>	<u>Sellu</u>	Clamps and Shelves	<u>Sellu</u>	Anchors No. of <u>3 B. 1 S. 2 H.</u>	<u>where</u>
Topsides <u>do</u>	<u>//</u>	Ceiling <u>part Sellu,</u>	<u>//</u>	Cables	<u>Sellu</u>
Wales <u>do</u>		Rudder <u>HA good</u>		Hawsers and Warps	
Plank (Bottom) and Counter <u>do</u>		Copper <u>Y M on F</u> When put on <u>nom</u>		Standing & Running Rigging	
General Observations and Opinion,		Caulking of Bottom, Deck, & Waterways. <u>Good where tested</u>			

She is now in good and efficient condition and fit in our opinion to remain as Classed.

Viz A. 1.

The Amount of Fee.....£ - : - is received by me.

Special.....2 - 2 - 0


Certificate (if required) : 5 : -

Committee's Minute 30th July 1867

Character assigned Cont G A 1

Joseph Kell.

Samuel Presing.

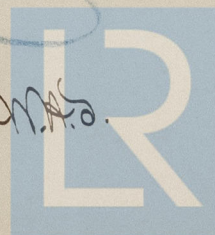

© 2021

Lloyd's Register
Foundation
LON652-0188