

Half time Survey.

28829

REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 426 Survey held at London Date Novth 19th to Dec^r 4th 1867.
 on the Ship "Woolloomooloo" Master A. Donald
 Tonnage 645 Built at Aberdeen When built 1852.
 By whom built Hood Owners Thompson
 Port belonging to Aberdeen Destined Voyage Sidney
 If Surveyed Afloat or in Dry Dock Blackwall dry Dock and East India St^h

Last Survey, No. 28060 Port London Classed A. 1. (4.66.)
 REPAIRS Now done. (Cont. 62.7 years)

Sighted bottom, the yellow metal stripped, & caulked from keel to metal line, also Butts &c. of topsides, and resheathed the bottom with yellow metal on felt.

The timbers and all air courses cleared, the latter being in accordance with Sec 37. the planking from the metal line up, being principally Teak, and Iron Bark, and in good condition, was scraped bright in the way of each mast, and on each side, from gunwale to metal line, ~~and~~ about 2 feet in width; (viz 6 places); drifted out 12 treenails, and 6 Iron bolts, from each side, the latter being in range of upper deck, the lower deck fastenings so far as could be ascertained being metal; The Windlass examined and stripped, and Chain Cables Ranged.

Renewed the following spars &c. the Fore topmast, the Fore and main topgallant-masts, and mizen topsail yard with Red and pitch pine.

Present Condition of the

Decks	<div style="font-size: 4em; transform: rotate(-90deg); display: inline-block;"> good where Sailed </div>	Treenails	<div style="font-size: 4em; transform: rotate(-90deg); display: inline-block;"> good where Sailed </div>	Windlass and Capstan	<div style="font-size: 4em; transform: rotate(-90deg); display: inline-block;"> good and efficient where Sailed </div>
Waterways		Breasthooks and Stenson		Pumps <u>2</u>	
Comings		Transoms, Pointers, and Crutches		Boats <u>3</u>	
Upper Deck Beams & Fastenings		Timbers of the Frame at the openings		Masts, Yards, &c. <u>good</u>	
Lower Deck Beams & Fastenings		Ditto Ditto at other places		Condition, how ascertained <u>insp^{ns} and enquiry</u>	
Planksheers		Keelsons		Sails	
Sheerstrakes		Clamps and Shelves		Anchors No. of <u>3 B. 1 S. 2 H</u>	
Topsides		Ceiling		Cables	
Wales		Rudder <u>Had good</u>		Hawsers and Warps	
Plank (Bottom) and Counter <u>caulked</u>		Copper <u>Mon F</u> When put on <u>Mon</u>		Standing & Running Rigging	
General Observations and Opinion,		Caulking of Bottom, Deck, & Waterways. <u>good where tested.</u>			

She is now in good and efficient condition and fit in our opinion to remain Classed A. 1. and to be marked in the Register Book (H. T. 12.67.)

The Amount of Fee.....£ - : - : is received by me,

Special.....2 - 2 - 0

Certificate (if required) : 5 : 16.12.67

Committee's Minute

Character assigned

17th December 1867


Cont^d 7/1

record 4M

H.T. 12.67

Joseph Allen.

Mr. Mann

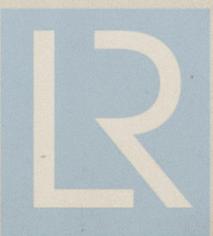

© 2021

Lloyd's Register Foundation

LON652-0481