

REPORT of SURVEY for REPAIRS.

* 31009

No. in Reg. Book. **No.** Survey held at London Date, first Survey 12 June Last Survey 3 July 1869
 on the Ship "Gosforth" Master Wright
 Tonnage 810 built at Shields When built 1856
 By whom built Smith Owners Smith & Co. South Shields
 Port belonging to Newcastle Destined Voyage India
 If Surveyed Afloat or in Dry Dock Green's dry dock

Last Survey, No. 31009 Port Low. Classed 10. A1 con 66-7

REPAIRS, &c. Now done as per Section 34 & 37 for Half time Survey
Yellow Metal Sheathing stripped, the timbers and all are
courses cleared. Bolts and Screws on each side driven
out in various parts of the ship, and the plank, Timber
Screws and Bolts, exposed found good with the
exception of what was renewed. The Windlass unhooked
and work lining stripped, and the chains ranged
on deck and found sufficient.

Now done, Screws in Trunks renewed with
9 Plank of Culling at Sum of Bilge, about fore hatch
split out and 8 Chocks renewed with English Oak on the
P.S.D.

Present Condition of the

Decks		Treenails		Windlass and Capstan	
Waterways		Breasthooks and Stemson		Pumps	<u>good</u>
Comings		Transoms, Pointers, and Crutches		Boats	
Upper Deck Beams & Fastenings		Timbers of the Frame at the openings		Masts, Yards, &c.	<u>good</u>
Lower Deck Beams & Fastenings		Ditto Ditto at other places		Condition, how ascertained	<u>from deck</u>
Plank sheers		Keelsons		Sails	<u>sufficient</u>
Sheerstrakes		Clamps and Shelves		Anchors No. of	<u>3 15 15 2 K</u>
Topsides		Ceiling		Cables	<u>sufficient</u>
Wales		Rudder		Hawsers and Warps	<u>good & sufficient</u>
Plank (Bottom) and Counter		Copper <u>Yellow Metal</u> When put on <u>1869</u>		Standing & Running Rigging	<u>good</u>
Engine Room Skylights		Caulking of		Cargo and Main Hatchways	<u>good</u>
Coal Bunker, Openings, Lids, &c.		Bottom, Deck, & Waterways	<u>good & when seen</u>	Hatches	<u>good</u>
Scuppers	<u>good</u>				

General Observations and Opinion,

Is now in good order and condition and eligible
in my opinion to remain as classed 10. A1 con 66-7
and be marked HT

The Amount of Entry Fee.....£ 2 : — : is received by me.

Special..... 3 : 3 : 0

Certificate (if required) : :

Committee's Minute 18

Character assigned



© 2021


Lloyd's Register

Foundation

LON 653-0439

31009.7 Son

Starboard Side and 8 Shake of Ceiling Split out at
turn of bidge abreast fore hatch and 4 Chocks renewed
with English Oak on Port Side. Ceiling Split out renewed
with Pitch Pine and all fastenings in way of same
renewed through all. Re caulked from Keel to Gunwale
and decks where required. Re Sheathed with Yellow
Metal on Sides.

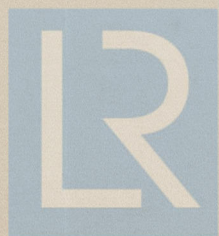

© 2021

Lloyd's Register
Foundation