

REPORT of SURVEY for REPAIRS, &c.

36.600

Rec 11.10.77

No. in
Reg. Book. No.

Survey held at

London

Date, first Survey 20/9/77

Last Survey

8 October

1877

on the

Bkr Chocolate Girl

Master N. Foiste

YEAR.

MONTH.

TONNAGE under Tonnage Deck

242

Ditto of Spar Deck, or Avoing Deck

Ditto of Poop

Ditto of Raised Qr. Dk.

Ditto of Houses on Deck

Ditto of Forecastle

Gross Tonnage

253

Crew Space, as per Rule

Register Tonnage, cut on Beam

244

Engine Room

Reg. Tons as St mer, cut on Bm.

Built at Littlehampton

When built

1869

Owners De Putron & Co

Port belonging to

London

Residence

By whom built Harvey

Destined Voyage

Grenada

If Surveyed Afloat or in Dry Dock

Afloat in West India Docks

Length of Poop

ft. Ditto, Forecastle

ft. Ditto, Raised Quarter Deck

Classed

Years assigned.

Character in Register Book.

Last Survey, No.

34176

Port

London

H.T. Low 74

10.44

REPAIRS, OR EXAMINATION AS PER RULE

upon Annual Survey.

On Starboard side 19 throat bolts of hanging knees and on the Port side 17 throat bolts of de renewed with copper. On Starboard side 15 knee bolts through beam and 9 on the Port side renewed with galvanized iron.

7 Lodging knees fitted to each side - viz. 3 in wake of fore mast - 2 in wake of main mast and 2 at mizen mast. all being fastened with copper to the ships side and galvanized iron through the beams.

Cause of Repairs to be clearly stated.

Present Condition of the

Decks

Good

Waterways

Dr

Comings

Dr

Upper Deck Beams & Fastenings

Dr

Lower Deck Beams & Fastenings

Dr

Planksheers

Dr

Sheerstrakes

Dr

Topsides

Dr

Wales

Dr

Plank (Bottom) and Counter

Dr where seen

Engine Room Skylights

General Observations, Opinion as to Class, &c.

Treenails

Good

Breasthooks and Stenson

Transoms, Pointers, and Crutches

Timbers of the Frame at the openings

Ditto Ditto at other places

Keelsons

Clamps and Shells

Ceiling

Rudder

Copper Y.M. over F When put on

Caulking of

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Bottom, Deck, & Waterways

Windlass and Capstan

Good

Pumps

Dr

Boats

Dr

Masts, Yards, &c.

Dr

Condition, how ascertained

From deck

Sails

Good

Anchors No. of

3B 1K

Cables

Good where seen

Hawsers and Warps

Dr

Standing & Running Rigging

Good

Cargo and Main Hatchways

Good

Hatches

Dr

The Amount of Entry Fee£ " : : ,

received by me,

11/10/77 Special£ 2 : 2 :

Certificate (if required)£ - : - :

(Travelling Expenses, if any, £)


Committee's Minute

16th October, 1877.

Character assigned

11A

Surveyor to Lloyd's Register of British and Foreign Shipping.

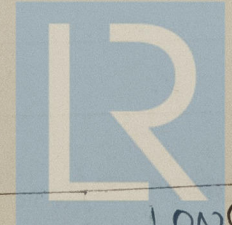

© 2021

Lloyd's Register

Foundation

[2,000-8/77.]

(The Surveyors are requested not to write on or below the space for Committee's Minute.)