

# Report of Survey for Repairs of Engines and Boilers.

39074

No.

(Received at London Office, 15. 4. 80)

No. in Reg. Book. Survey held at London.

Date, first Survey March 23<sup>rd</sup> Last Survey April 10<sup>th</sup> 1880

6 on the Machinery of the S. S. "Dunrobin Castle."

(Number of Visits

Year

Tonnage, Gross 2811

Built at Glasgow

When built 1875

Ditto, Net 1784

Owners D. Currie & Co.

Port belonging to London

Year

Diameter of Cylinder 47" x 75"

Engines made by R. Napier & Sons.

When made 1875

Year

Length of Stroke 48"

Boilers made by R. Napier & Sons.

When made 1875

Year

Pressure of Steam 60 lbs.

If Surveyed Afloat or in Dry Dock Dry Dock & Afloat Classed

Years assigned.

Character in Register Book.

100 A1

Registered Horse Power 300

Lloyd's M.C. 1.76

Last Survey No.

Port

Particulars of Repairs and Examination Of Engines and Boilers in accordance with the requirements of S. S. No 1. Examined cylinders which were found in good condition. Slide valves steam receiver and steam passages examined which were all found to be in good condition. Crank shaft examined and found in good condition. Thrust bearing and all tunnel shaft bearings examined and found in good condition. Air pumps and circulating pump examined new valves been fitted throughout Bilge injection valve examined, in good condition. Examined Boilers, bottoms of furnaces in Port After boiler (middle furnace) and middle furnace Starb. Forward found to be pitted, these plates have been doubled for the whole length. Examined Superheater which was in good condition. Safety Valves examined and found in good condition. Vessel placed in dry dock, examined sea connections which were in good condition. Propeller examined and found in good condition. Shaft down about  $\frac{1}{8}$ ". Tested Safety Valves under steam to the working pressure of 60 lbs. per sq. inch.

General Observations, Opinion, and Recommendation:— The Engines and Boilers of this ship being now in good and safe working order, are eligible in my opinion to be marked in the Register Book with Lloyd's M.C. 4.80

Survey or Registering Fee 15/4/80 ... £ 1 : 10 : 0

Fee ... 2/1/80 ... £ 3 : 3 : 0

Certificate (if required) ... £ — : — : —

Travelling Expenses, if any, £ —

received by me,

31/10/80

C. E. Stromeyer & Leo. C. Williamson.


Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

Friday April 16th 1880

Assigned

Lloyd's M.C. 4.80

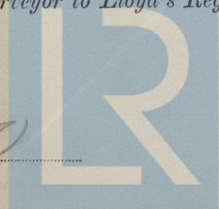

Lloyd's Register Foundation

LON664-0239



Not submitted that this  
vessel is eligible to  
have the notification

Lloyd's M.C. 14.88

Recorded in the  
Register Book

LM

14/4/88



© 2021

Lloyd's Register  
Foundation