

(40364)

Report of Survey for Repairs of Engines and Boilers.

(Received at London Office, (R. d 5/5/81.))

No. _____

No. in Reg. Book. _____ Survey held at London Date, first Survey April 14 Last Survey Apr. 26 1881

640 on the Machinery of the S. S. "Hutton Chaytor" (Number of Visits 2 Year _____)

Tonnage, Gross <u>598</u>	Built at <u>Newcastle</u>	When built <u>1855</u>
Ditto, Net <u>447</u>	Owners _____	Port belonging to <u>London</u> Year _____
Diameter of Cylinder <u>26" x 50"</u>	Engines made by <u>J. Jackson & Co.</u>	When made <u>1870</u> Year _____
Length of Stroke <u>30"</u>	Boilers made by <u>Ditto</u>	When made <u>1870</u> Year _____
Pressure of Steam <u>60 lbs.</u>	If Surveyed Afloat or in Dry Dock <u>Britannia dry dock & Afloat</u>	Years assigned. _____ Character in Register Book. <u>A 1</u>
Registered Horse Power <u>80</u>	(State name of Dock.)	
Last Survey No. _____	Port _____	

Particulars of Repairs and Examination For Special Survey

(State cause of Repairs.)

Vessel placed in dry dock, sea connections examined & found to be in good condition. Stem Bush found to be $1\frac{1}{2}$ " worn, a new bush has been fitted. Tail shaft examined the shaft was found to be cased with brass the whole length of Stem tube, the parts that were visible were found in good condition. Propeller replaced in an efficient manner. On examining the boiler it was found that the tubes were all drawn, and the furnaces cut out the front plate round the bottom to which the furnaces were riveted found to be in a very defective condition, recommended that this part be renewed, and the Superheater opened out. On the next visit to the vessel I was informed that the owners did not require the survey to be continued

General Observations, Opinion, and Recommendation:— Under the above mentioned circumstances no further survey was held.

Entry or Registering Fee... £ : :
(per Section 27.)
Survey Fee (per Section 28) ... £ 2 : 2 : received by me, }
Certificate (if required) ... £ : : 188 }
to be sent as per margin.


(Travelling Expenses, if any, £ _____)

Geo. E. Wilmison
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute _____

Friday, May, 13th 1881.

Assigned _____

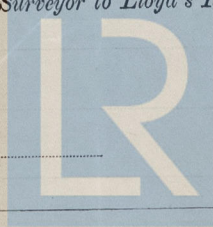

Lloyd's Register
Foundation

LON665-0500