

Report of Survey for Repairs of Engines and Boilers.

40739

No. _____ (Received at London Office, 22. 8. 81.)

No. in Reg. Book. Survey held at London Date, first Survey 9th Aug Last Survey 12 August 1881

57 on the Machinery of the S. S. Ahydos. (Number of Visits 2)

Tonnage, Gross 1118 Built at Glasgow When built 1871

Ditto, Net 715 Owners Globe Steam S. Co. Port belonging to London

Diameter of Cylinder 31 54 Engines made by London & Glasgow Co. When made 1871

Length of Stroke 33 Boilers made by " When made 1871

Pressure of Steam 65 If Surveyed Afloat or in Dry Dock Victoria Graving Dock Classified 100 A1

Registered Horse Power 130 (State name of Dock.) Years assigned 12.79

Last Survey No. _____ Port B & M. S. 1.60

Particulars of Repairs and Examination Annual. Age of Boilers

(State cause of Repairs.)

Examined sea cocks and connections, found lignum vita of stern bust worn down recommended renewing it which has been done. Found tail shaft to be deeply corroded close to aft brass liner, recommend new tail end to be welded on & to be fitted with nut & key which has been done.

Examined Boilers found the lower row of main stays corroded more than rest but they do not endanger the boilers the rest of the boilers appeared in good condition

General Observations, Opinion, and Recommendation:— As far as seen the machinery & Boilers of this vessel appear to be in a safe working condition and eligible in my opinion to have the notification B.S. 881 recorded in the Register Book

Entry or Registering Fee... £ : :
(per Section 27.)


Survey Fee (per Section 28) ... £ 2 : 2 : ~ received by me, }
Certificate (if required) ... £ : : 188 }
to be sent as per margin.

(Travelling Expenses, if any, £ _____)

Committee's Minute Friday, August, 26th 1881.

Assigned B.S. 881

C. E. Brown
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

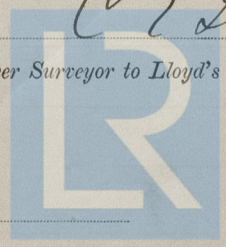

Lloyd's Register
Foundation

LOW 666 - 0113

It is submitted that this vessel
is eligible to have the
notification Ins 1, 80 &
BS 8, 81 recorded
subject to the boilers
being a gain & d
in 12 months as
per rule

M
20/8/81



© 2021

Lloyd's Register
Foundation