

Report of Survey for Repairs of Engines and Boilers.

No.

(Received at London Office, 30.8.81)

No. in Reg. Book. Survey held at London

Date, first Survey July 29th Last Survey Aug. 5th 1881

1423 on the Machinery of the S. S. 'Aurora'

(Number of Visits 2)

Tonnage, Gross 711

Built at Newcastle

When built 1863

Ditto, Net 446

Owners Lon. Ship. Co.

Port belonging to London

Diameter of Cylinder 26" + 5"

Engines made by Compd. Palmers Co.

When made 1872

Length of Stroke 30"

Boilers made by Ditto

When made 1872

Pressure of Steam 75 lbs.

If Surveyed Afloat or in Dry Dock Pontoon
(State name of Dock.)

Classed 95A1

Registered Horse Power 160

Last Survey No.

Port

Lloyd's M.C. 7.80

Particulars of Repairs and Examination For Annual Survey & Limited
(State cause of Repairs.)

Certificate on account of age of Boilers.
Vessel placed on Pontoon sea connections examined & found to be in good condition. Boilers examined - Furnaces & Combustion Chambers found in ^{fairly} good condition. The top row of screwed stays at back of combustion chambers found somewhat corroded. Fore & Aft stays in fairly good condition. Shells of Boilers in fairly " " " Superheater " " " Safety Valves examined found to be in good condition & correctly loaded to the working pressure of 75 lbs. per sq. in.

General Observations, Opinion, and Recommendation:— The Boilers being now in good & safe working condition renders the vessel eligible in my opinion to remain as classed & have the notification B.S. 7.81 recorded, provided that the boilers are again examined within 12 mths. as per rule.

Entry or Registering Fee... £ 3 9 1881

Survey Fee (per Section 28) ... £ 2 : 2 : "

Certificate (if required) ... £ " : " : "

received by me,

8/9/1881


(Travelling Expenses, if any, £)

Committee's Minute

Friday, September, 2nd 1881.

Assigned

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

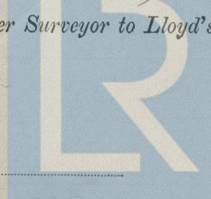

Lloyd's Register Foundation

(Insert Character precisely as in the Register Book.)

2410-0142

It is submitted that this vessel
is eligible to have the
notification B.L. 7.81 records
subject to the boiler
being again & B in 12
months as per rule

Jm
30/8/80



© 2021

Lloyd's Register
Foundation