

# Report of Survey for Repairs of Engines and Boilers.

No. \_\_\_\_\_ (Received at London Friday, February 17th 1882)

No. in Reg. Book. Survey held at London Date, first Survey Jan. 24<sup>th</sup> Last Survey Feb. 8<sup>th</sup> 1882

255 on the Machinery of the S.S. "Eldorado" (Number of Visits 5)

Tonnage, Gross 3332 Built at Stull When built 1873

Ditto, Net 2157 Owners A. Gray & E. S. Davies Port belonging to Glasgow

Diameter of Cylinder 47" x 90" Engines made by Parsons & Co. When made 1873

Length of Stroke 50" Boilers made by Ditto When made 1873

Pressure of Steam 60 lbs. If Surveyed Afloat or in Dry Dock Afloat at the (State name of Dock.)

Registered Horse Power 450 Classified 100A1

Last Survey No. \_\_\_\_\_ Port Lloyds M.C. 7.78.

Particulars of Repairs and Examination According to the requirements for

Special Survey No 2. (In part)

Examined Cylinders, Slides & Valves in good condition

" Crank shaft & Thrust " " "

" Air, circulating Snd & Bidge pumps " "

Examined Boilers, Furnaces & Combustion chambers

found to be in good condition, stays in good condition

several having apparently been recently renewed.

Front seams round bottom of the two after boilers

all the rivets have been renewed. Shells of boilers

underneath found to be in good condition.

Superheater found to be in good condition.

Safety Valves examined found in good condition

& tested under steam to the working pressure

of 60 lbs. per sq. in.

General Observations, Opinion, and Recommendation:— The machinery being now  
in good & safe working condition renders the vessel eligible in my  
opinion to be marked with Lloyds M.C. 2.82. provided that the sea  
connections, propeller & stern bush are examined when the vessel  
is placed in dry dock.

Entry or Registering Fee... £ 1 : 10 : 0

Survey Fee (per Section 28) ... £ 4 : 4 : 0 received by me, C. E. S.

Certificate (if required) ... £ : 5 : 0 25/4/1882

(Travelling Expenses, if any, £ \_\_\_\_\_)


Committee's Minute

Tuesday, February, 21st 1882

Assigned

Lloyds Ref 2, M  
Ref 2, M

Geo. E. Merriamson.  
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

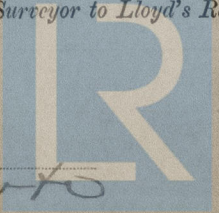

Lloyd's Register  
Foundation

LON 667-0391



The Machinery of this vessel has  
been examined at S.P. No 2 and  
is reported to be in good condition  
but as the vessel has not  
been in dry dock her sea  
connections have not been  
examined, submitted that  
she is eligible to have  
Lloyd's M.C. 2.52 -  
and her sea connections  
should be examined  
on her return

M 16.2.52



© 2021

Lloyd's Register  
Foundation