

# Report of Survey for Repairs of Engines and Boilers.

No. 41347 (Received at London Office, 1.4.82)

No. in Reg. Book. 157 Survey held at London Date, first Survey Feb 9<sup>th</sup> Last Survey Mar. 18<sup>th</sup> 1882

on the Machinery of the S. S. "Edith" (Number of Visits 5)

Tonnage, Gross 89 Built at Berwick When built 1878

Ditto, Net 53 Owners Walter Brown Port belonging to London

Diameter of Cylinder 12" Engines made by Wardhaugh & Bulmer When made 1878

Length of Stroke 16" Boilers made by Ditto When made 1878

Pressure of Steam 45 lbs. If Surveyed Afloat or in Dry Dock London D. D. R. + aft. Classified A. 1

Registered Horse Power 20 (State name of Dock.)

Last Survey No. 41298 Port Lon Lloyd's M. C. 4.78.

## Particulars of Repairs and Examination For Annual Survey

Boiler examined, (this is a vertical boiler with three cross tubes) the lower tube found to have two patches bolted on underneath, recommended these patches to be removed for further examination, the iron round the hole being good the plate was refitted. Stays from crown of furnace renewed & stay plates from an angle iron up & down the uprights renewed, three in number. Boiler tested with water to 90 lbs. per sq. in. & found to be tight. A new safety valve & gun metal spindle has been fitted, & the valve loaded with a direct weight to 45 lbs. per sq. in. Vessel placed in dry dock sea cocks & connections found to be in good condition.

General Observations, Opinion, and Recommendation:— As far as seen of the machinery the vessel is eligible to remain as classed, & has the notification B. S. 3. 82 recorded in the Register Book.

Entry or Registering Fee... £ 11/4 : : :  
 Survey Fee (per Section 28) ... £ 2 : 2 : received by me, C. R. D.  
 Certificate (if required) ... £ : : 13/4 1882  
 to be sent as per margin.


(Travelling Expenses, if any, £ )

Geo. E. Milner  
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute Tuesday, April, 11th 1882

Assigned

B. S. 3. 82  
[Signature]

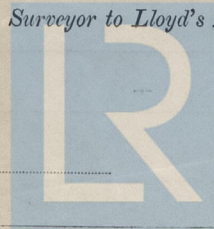

Lloyd's Register  
 Foundation

LN 668-0027



This submitted that the  
vessel is eligible to have  
the notification Pt. 3, 52  
recorded subject to  
the boiler being again  
surveyed as per rule

M 1/4/82



© 2021

Lloyd's Register  
Foundation