

# Report of Survey for Repairs of Engines and Boilers.

No.

No. in Reg. Book. Survey held at London.

Date, first Survey Dec. 29 Last Survey Dec. 30 1882

557. on the Machinery of the S. S. "Shoreham"

(Number of Visits 2)

Tonnage, Gross 491

Built at Port Glasgow.

When built 1872

Ditto, Net 293

Owners S. Clarke & Co.

Port belonging to London

Diameter of Cylinder 24" + 42"

Engines made by Walter Henderson & Co.

When made 1872

Length of Stroke 30"

Boilers made by

When made 1879

Pressure of Steam 60 lbs.

If Surveyed Afloat or in Dry Dock Afloat  
(State name of Dock.)

Classed 90A1

Registered Horse Power 80

Last Survey No.

Port

L.M.C. 2.81

## Particulars of Repairs and Examination For Annual Survey.

(State cause of Repairs.)

Vessel placed in dry dock, sea connections examined & found to be in good condition. Propeller & its connections found to be sound & the tail shaft down 3/16" in stern bush. Boilers examined, tubes renewed, Furnaces in good condition. Combustion chamber common to the three furnaces one riveted patch at bottom back of combustion chamber taken off & a new patch fitted with two through screw stays. Forty five new screwed stays fitted at back & bottom of comb. chr. Fore & aft stays found to be good.

General Observations, Opinion, and Recommendation:— As far as seen this vessel appears eligible to remain as classed, & have the notification B. S. 12.82 recorded in the Register Book.

Entry or Registering Fee... £ : :  
(per Section 27.)

Survey Fee (per Section 28) ... £ 1 : 1

Certificate (if required) ... £ - : 2 : 6

(Travelling Expenses, if any, £)

received by me,

10 Jan 1883

Geo. E. Milnerison


Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

Frida, 5th January, 1883.

Assigned

T.B.W. B.S. 12.82

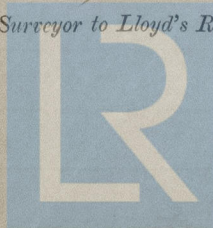

Lloyd's Register Foundation

(State of Repairs is also sent on the Hull of the Ship. Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.)

(The Surveys are requested not to write on or below the space for Committee's Minute.)

Insert Character precisely as in the Register Book.

LON 669-0416



It is submitted that this vessel is  
eligible to remain as blessed and  
have the Notification B.S. 12.82 recorded

D.S.

2/1/82.



© 2021

Lloyd's Register  
Foundation