

ANNUAL SURVEYS.

42882

(Received at London Office) FRIDAY 21 SEPT 1883

No. 505 Survey held at London Date, first Survey 28th August Last Survey 15th Sept 1883
 No. in Reg. Book. on the Barque "Durban" Master F. Renouf
 Net 332 Built at London When built 1870 Month 3rd
 Tonnage Gross 345 Under Dk. 275 By whom built Salisbury Owners Bullard, King & Co
 Port belonging to London Destined Voyage Zanzibar
 If Surveyed Afloat or in Dry Dock In Horseferry Dry Dock Society's Freeboard (if assigned) as painted on Ship
 (State Name of Dock.)

Last Survey, No. 41427 Port of Low Classed 11 Years assigned. 11 Character in Register Book. A.1.
 Present Condition of the Decks good Treenails good Cont. Lon. Mar. St. 7 4.82.
 Waterways D^c Breasthooks and Stemson D^c
 Comings D^c Transoms, Pointers, and Crutches D^c
 Upper Deck Beams & Fastenings D^c Timbers of the Frame at the Openings D^c
 Lower Deck Beams & Fastenings D^c Ditto ditto at other places not seen
 Planksheers D^c Keelsons good
 Sheerstrakes D^c Clamps and Shelves D^c
 Topsides D^c Ceiling D^c
 Wales D^c Rudder D^c
 Plank (Bottom) and Counter D^c Copper or Y.M. good When put on 5.81
 Caulking of Bottom, Deck, & Waterways good
 Engine Room Skylights Coal Bunkers, Openings, Lids, &c. Scuppers good Cargo and Main Hatchways good Hatches good
 General Observations, Opinion as to Class, &c. The bottom has been sighted and the yellow metal sheathing repaired. The caulking of bottom tested and found satisfactory. The fore mast and the jibboom renewed. This vessel is in good and efficient condition and eligible in my opinion to remain as classed.

TUESDAY 25 SEPT 1883

Committee's Minute

Character assigned

Coat 7

J. H. Truscott.

Surveyor to Lloyd's Register of British and Foreign Shipping.

Certificate (if required, to be sent as per margin) Paid 18

No. 505 Survey held at London Date, first Survey 28th August Last Survey 15th Sept 1883


No. in Reg. Book. on the Barque "Durban" Master F. Renouf
 Net 332 Built at London When built 1870 Month 3rd
 Tonnage Gross 345 Under Dk. 275 By whom built Salisbury Owners Bullard, King & Co
 Port belonging to London Destined Voyage Zanzibar
 If Surveyed Afloat or in Dry Dock In Horseferry Dry Dock Society's Freeboard (if assigned) as painted on Ship
 (State Name of Dock.)

Last Survey, No. 41427 Port of Low Classed 11 Years assigned. 11 Character in Register Book. A.1.
 Present Condition of the Decks good Treenails good
 Waterways D^c Breasthooks and Stemson D^c
 Comings D^c Transoms, Pointers, and Crutches D^c
 Upper Deck Beams & Fastenings D^c Timbers of the Frame at the Openings D^c
 Lower Deck Beams & Fastenings D^c Ditto ditto at other places not seen
 Planksheers D^c Keelsons good
 Sheerstrakes D^c Clamps and Shelves D^c
 Topsides D^c Ceiling D^c
 Wales D^c Rudder D^c
 Plank (Bottom) and Counter D^c Copper or Y.M. good When put on 5.81
 Caulking of Bottom, Deck, & Waterways good
 Engine Room Skylights Coal Bunkers, Openings, Lids, &c. Scuppers good Cargo and Main Hatchways good Hatches good
 General Observations, Opinion as to Class, &c. The bottom has been sighted and the yellow metal sheathing repaired. The caulking of bottom tested and found satisfactory. The fore mast and the jibboom renewed. This vessel is in good and efficient condition and eligible in my opinion to remain as classed.

Committee's Minute

Character assigned

Certificate (if required, to be sent as per margin) Paid 18

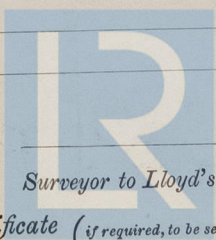

© 2021

Lloyd's Register Foundation

(If a Steam Ship, state if a Report is also sent on the Machinery)

(Form No. 3 for Annual Survey, when there are no repairs. 4000-18/83.)

(Insert Character precisely as in Register Book.)

(Insert Character precisely as in Register Book.)

1410149207