

Report of Survey for Repairs of Engines and Boilers.

No. _____ (Received at London Office, _____)
No. in Reg. Book. Survey held at London Date, first Survey Nov. 8th Last Survey Dec. 6th 1883

123 on the Machinery of the S. S. Harter (Number of Visits 6)
Tonnage, Gross 1844 Built at Stretton When built 1879
Ditto, Net 1196 Owners Shaw, Bushby & Co. Port belonging to London
Diameter of Cylinder 40" & 72" Engines made by C. D. Holmes & Co. When made 1879
Length of Stroke 54 Boilers made by Ditto When made 1879
Pressure of Steam 75 lbs. If Surveyed Afloat or in Dry Dock Smith & Co. D. O. K. Lift Years assigned 100A1
Registered Horse Power 300 (State name of Dock.)
Last Survey No. _____ Port L.M.C. 3.79.

Particulars of Repairs and Examination For Special Survey No 1

Examined cylinders, Slides, Air, circulating feed and Bilge pumps & valves all found to be in good condition. Crank shaft & thrust " " " "

Boilers examined, a small blister found in middle furnace of Starboard boiler, this has been pained down at edges & does not appear to be of any consequence, a few leaks in shells have been caulked, the rest of the boilers found to be in good condition. Safety valves examined & " " " & set under steam to the working pressure of 75 lbs. per sq. in.

Vessel placed in dry dock sea connections examined & found to be in good condition. Propeller disconnected & laid up Stern bush, when it was found that the tail shaft was flawed at small end of cone. The stern bush has been renewed & a new tail shaft fitted to former propeller.

General Observations, Opinion, and Recommendation:— The machinery being now in good & safe working condition renders the vessel eligible in my opinion to be marked in the Register Book with L.M.C. 12.83 provided that the boilers are again examd. within 2 yrs. as per rule.

Entry or Registering Fee... £ — : — :
Survey Fee (per Section 28) ... £ 4 : 4 :
Certificate (if required) ... £ : :
(Travelling Expenses, if any, £ _____)


received by me, 12 Dec 1883

Geo. E. Thompson

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute TUESDAY 11 DEC 1883 188

Assigned Shaw 12, 83

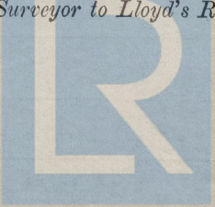

Lloyd's Register Foundation

(State if Report is also sent on the Hull of the Ship...)

(The Surveyors are requested not to write on or below the space for Committee's Minute.)

Insert Character precisely as in the Register Book.

L740-149N07

It is submitted that this vessel is
eligible to have the notification I.M. 6
12.83 recorded subject to the resurvey
of boilers as per Rule.

D.F.

7/12/83



© 2021

Lloyd's Register
Foundation