

43314
Report of Survey for Repairs of Engines and Boilers.

No. _____ (Received at London Office, FRIDAY 21 DEC 1883)
No. in Reg. Book. Survey held at London Date, first Survey Nov. 22nd Last Survey Dec. 18th 1883
459 on the Machinery of the S.S. "Celtic Monarch" (Number of Visits 6)
Tonnage, Gross 2014 Built at Newcastle When built 1879
Ditto, Net 1308 Owners Royal Exch. Shppg. Co. Port belonging to London
Diameter of Cylinder 32" 46" Engines made by J. Shaw & Co. When made 1879
Length of Stroke 48" Boilers made by Do. When made 1879
Pressure of Steam 75 lbs. If Surveyed Afloat or in Dry Dock Aft. M'lvoll. Dry Dock Years assigned 100A1
Registered Horse Power 200 (State name of Dock.) Character in Register Book.
Last Survey No. _____ Port L.M.C. 3. 82.

Particulars of Repairs and Examination For Special Survey No 1
(State cause of Repairs.)

Boilers examined, some stays in two of combustion chamber found to have been renewed, & a rivet fitted in middle furnace of port boiler through a blister, otherwise the boilers appear to be in good condition. Safety valves in good condition. Fusel placed in dry dock sea connections examined & found to be in good condition. Propeller & its connections found to be sound & the tail shaft a good working fit in stern bush.

Safety valves tested under steam to 75 lbs per sq. in.
Examined Air, circulating Feed & Bilge pumps, all found to be in good condition.

General Observations, Opinion, and Recommendation — The machinery being now in good & safe working condition renders the vessel eligible in my opinion to be marked in the Register Book with T.M.C. 12. 83 provided that the boilers are again submitted for survey within 2 yrs. as per rule.

Entry or Registering Fee... £ — : — :
(per Section 27.)

Survey Fee (per Section 28) ... £ 4 : 4 :
4/11/84

Certificate (if required) ... £ : 5 :
to be sent as per margin.

(Travelling Expenses, if any, £)

received by me, 448
8/1 1884

C. E. Stromeyer &

Geo. E. Nicolson


Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

FRIDAY 4 JAN 1884 188

Assigned

L.M.C. 12, 83

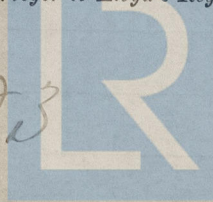

Lloyd's Register
Foundation

250-159207

It is submitted that this vessel
is eligible to have the notification
Lm 6 12. 83 recorded subject to
the resurvey of boilers as per Rule

D.F.

20/12/83



© 2021

Lloyd's Register
Foundation