

Report of Survey for Repairs of Engines and Boilers.

No. _____ (Received at London Office) **FRIDAY 22 FEB 1884**
 No. in Reg. Book. Survey held at London Date, first Survey Feb. 15th Last Survey Feb. 19th 1884

59 on the Machinery of the S. S. "Nautilus" (Number of Visits 4)
 Tonnage, Gross 718 Built at Sunderland When built 1874
 Ditto, Net 467 Owners Gen. Stm. Nav. Co. Port belonging to London
 Diameter of Cylinder 26" + 47" Engines made by G. Clarke When made 1874
 Length of Stroke 33" Boilers made by Dr. When made 1874
 Pressure of Steam 60 lbs. If Surveyed Afloat or in Dry Dock Offd. Lun. S. Dr. (State name of Dock.)
 Registered Horse Power 95 Character in Register Book. 90A1
 Last Survey No. _____ Port L.M.C. 12.81.

Particulars of Repairs and Examination For Special Survey No 3.

(State cause of Repairs.)
 Vessel placed in dry dock sea connections examined & found to be in good condition. Propeller disconnected tail shaft drawn in, examined & found to be in good condition, stern bush renewed & propeller replaced. Examined, cylinders, slides, air, circulating, feed & bilge pumps & valves, & pumping arrangements: all found in good condition. Examined crane, thrust, & tunnel shafting all found to be in good condition. Boiler examd: lower part of bases of combustion chambers found to be doubled & 4 exha stays fitted, middle furnace found to have a patch about 14" x 14" in crown which appears to be sound. Bottoms of shells covered with brass patches round circumferential seams. Safety valves examined found in good condition & loaded with live weights to 60 lbs. per sq. in. Donkey Boiler & safety valves found to be in good condition & loaded with dead weights to 40 lbs per sq. in.


General Observations, Opinion, and Recommendation:— The machinery being now in good & safe working condition the vessel is eligible in my opinion to be marked in the Register Book with T. M. C. 2. 84 provided that the boilers are again examined within 12 mths: as per rule.

Entry or Registering Fee... £ — : — : —
 Survey Fee (per Section 28) ... £ 3 : 3 : — received by me, Geo. E. Meremson
 Certificate (if required) ... £ — : — : —
 to be sent as per margin.
 (Travelling Expenses, if any, £ _____)

Committee's Minute FRIDAY 22 MARCH 1884 188

Assigned L.M.C. 2.84

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

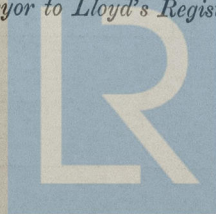

Lloyd's Register Foundation

LON 672-0281

(State of Report is also sent on the Hull of the Ship... Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.)

Insert Character precisely as in the Register Book.