

# Report of Survey for Repairs of Engines and Boilers.

No. \_\_\_\_\_ (Received at London Office, 26. 5. 84.)  
 No. in Reg. Book. Survey held at London Date, first Survey 9 April Last Survey 29 April 1884  
544 on the Machinery of the S. S. Mary Mason (Number of Visits 3)  
 Tonnage, Gross 766 Built at Newcastle When built 1865  
 Ditto, Net 478 Owners J. Fenwick & Sons Port belonging to Newcastle  
 Diameter of Cylinder 26. 51. Engines made by McC Eng Wks. Co When made 1872  
 Length of Stroke 30 Boilers made by \_\_\_\_\_ When made 1872  
 Pressure of Steam 70 If Surveyed Afloat or in Dry Dock Victoria Dk. (State name of Dock.)  
 Registered Horse Power 99 Years assigned. 10. 83. Character in Register Book. A 1.  
 Last Survey No. 42978 Port Son Ind. 11. 81. 138583.

Particulars of Repairs and Examination Annual Boiler Survey  
 (State cause of Repairs.)

Repairs to Boilers.  
 Examined Superheater and found it in a good condition with the exception of a few stays which have been renewed.  
 Examined the boilers and found them in a good condition with the exception of two of the furnaces. These have been renewed. The boilers appeared to be in a good condition when tested under steam.


General Observations, Opinion, and Recommendation:— As far as seen the machinery of this vessel appears to be in a safe working condition and is in my opinion eligible to have the notification B.S. 484 recorded in the Register Book.

Entry or Registering Fee... £ - : - : -  
 Survey Fee (per Section 28) ... £ 2 : 2 : - received by me,  
 Certificate (if required) ... £ : : 30/11/84 1884  
 (Travelling Expenses, if any, £ )

C. S. Bromley  
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping

Committee's Minute TUESDAY 27 MAY 1884 188

Assigned [Signature]

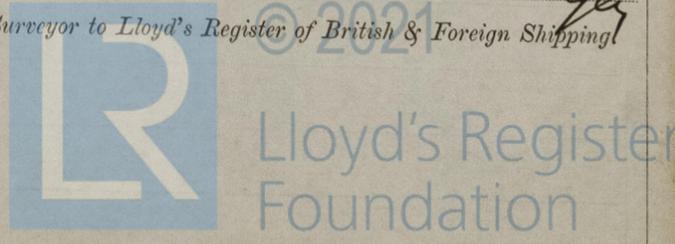

(State if Report is also sent on the Hull of the Ship  
 (Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.)

Insert Character precisely as in the Register Book.

It is submitted that this vessel is  
eligible to have the notification  
B.S. 484 recorded the boilers  
being subject to resurvey on  
account of their condition

D. J.

13/5/84



© 2021

Lloyd's Register  
Foundation

Register of Survey for Boilers of Engines and Boilers