

43907

Report of Survey for Repairs of Engines and Boilers.

No.

(Received at London Office,)

No. in Reg. Book. Survey held at London

Date, first Survey May 8th Last Survey May 30th 1884

762 on the Machinery of the S.S. "City of Ghent"

(Number of Visits 6)

Tonnage, Gross 199

Built at Grimby

When built 1871

Ditto, Net 119

Owners D. C. Thomas

Port belonging to London

Diameter of Cylinder 14" + 28"

Engines made by Midas + Dunsmuir

When made 1881

Length of Stroke 20

Boilers made by A. Hodge + Sons

When made 1881

Pressure of Steam 80 lbs.

If Surveyed Afloat or in Dry Dock Aft. L. G. D. D. D.
(State name of Dock.)

Classed

Years assigned. Character in Register Book.
A 1

Registered Horse Power 40

Last Survey No.

Port

T.M.C. 6.81.

Particulars of Repairs and Examination In Special Survey No 3.

(State cause of Repairs.)

Examd: cylinders, slides, air, circulating, fed + bidge pumps + valves + pumping arrangements all found to be in good condition. Crank shaft + thrust bearing examined + found in good condition. Boiler examined the back plate of combustion chamber on Starbd. side found to be slightly buckled, two extra stays have been fitted at some former time, a six inch iron found on back + front plates in steam space. Three 3" holes have been cut in after iron to enable back combustion chamber plates to be cleaned, stays in good condition shell in good condition. Tessel placed in dry dock sea connections examined + found to be in good condition. - Propeller disconnected. Tail shaft drawn in + examined found to be in good condition, a new cast iron bush fitted in stern tube + propeller replaced. Safety valves overhauled + adjusted under steam to the working pressure of 80 lbs per sq. in. Engines moved under steam when everything was found to be satisfactory.

General Observations, Opinion, and Recommendation:— The machinery being now in good + safe working condition renders the vessel eligible in my opinion to be marked in the Register Book with T.M.C. 4.81 provided that the boilers be again examined within 12 mths. as per rule.

Entry or Registering Fee... £ — : — : —

Survey Fee (per Section 28) ... £ 3 : 3 : —

Certificate (if required) ... £ : : —

(Travelling Expenses, if any, £)

received by me,

18/6 1884

Geo. J. Merriam


Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

TUESDAY 17 JUNE 1884 188

Assigned

L. M. C. 4.81

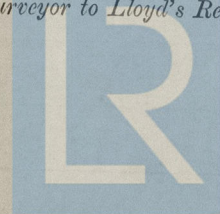

Lloyd's Register Foundation

LON672-0602

It is submitted that this vessel
is eligible to have the notification
Ln 6 4.84 recorded

W.F.
3/6/84



© 2021

Lloyd's Register
Foundation