

44061

# Report of Survey for Repairs of Engines and Boilers.

(Received at London on FRIDAY 13 JUNE 1884)

No. \_\_\_\_\_  
No. in Reg. Book. Survey held at London Date, first Survey June 5<sup>th</sup> Last Survey June 12<sup>th</sup> 1884

451 on the Machinery of the S. S. "Lisbon" (Number of Visits 4)

Tonnage, Gross 1334 Built at N. Hartlepool When built 1871

Ditto, Net 860 Owners J. Hall & Co. Port belonging to London

Diameter of Cylinder 27" x 57" Engines made by Blair & Co. When made 1871

Length of Stroke 36" Boilers made by Do. When made 1871

Pressure of Steam 70 lbs. If Surveyed Afloat or in Dry Dock Regent D. Dock Years assigned 100 Character in Register Book A1

Registered Horse Power 120 (State name of Dock.) Classed 100 A1

Last Survey No. \_\_\_\_\_ Port B. & M. S. 11. 32.

## Particulars of Repairs and Examination In Annual Survey.

(State cause of Repairs.)

Vessel placed in dry dock sea connections examined & found to be in good condition. Propeller & its connections sound & the tail shaft a good fit in stern bush. Main Boilers examined. One furnace in Port Boiler has two riveted patches in crown plate. Combustion chambers have riveted stays between existing ones about 2ft. up one back has covering plate & two others have riveted patches, about 15" from bottom. Stays found to be in good condition. Shells have some covering patches fitted underneath at landing edges. Safety valves found to be in good condition & tested under steam to the working pressure of 65 lbs. per sq. in.

General Observations, Opinion, and Recommendation:— The Boilers being now in good & safe working condition & the machinery as far as seen renders the vessel eligible in my opinion to be marked in the Register Book with B. S. C. 84 provided that the boilers are again examined within 12 mths. as per rule.

Entry or Registering Fee... £ — : —

Survey Fee (per Section 28) ... £ 2 : 2 : — received by me, Geo. E. Milner

Certificate (if required) ... £ : : 20 Aug 1884


to be sent as per margin.

(Travelling Expenses, if any, £ \_\_\_\_\_)

Committee's Minute TUESDAY 5 AUGUST 1884 188

Assigned B. S. C. 84

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

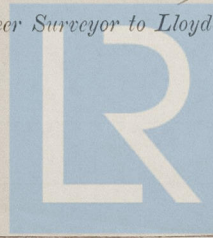

Lloyd's Register Foundation

LON673-0104



It is submitted that this vessel is  
eligible to have the notification  
B.S. 6.44 recorded the boilers being  
subject to resurvey as per Rule.

W.F.

12/6/84



© 2021

Lloyd's Register  
Foundation