

# Report of Survey for Repairs, &c., of Engines & Boilers.

No.

(Received at London Office, 16 4 85)

No. in Reg. Book. 368 Survey held at London Date, first Survey Apl. 1 Last Survey Apl. 14<sup>th</sup> 1885  
 on the Machinery of the S. S. "Berrington" (Number of Visits 3)  
 Tonnage, Gross 794 Built at Newcastle When built 1865-9  
 Ditto, Net 508 Owners J. Fenwick & Sons Port belonging to Sunderland.  
 Diameter of Cylinder 25" x 48" Engines made by Palmers Co. When made 1876  
 Length of Stroke 30 Boilers made by Do. When made 1876  
 Pressure of Steam 75 lbs. If Surveyed Afloat on in Dry Dock Pontoon Craft Classed 80A1  
 Registered Horse Power 99  
 Last Survey No. Port L.M.C. 12.82. B.S. 2.84.

## Particulars of Repairs and Examination For Annual Survey

(State clearly the cause of Repairs if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

Vessel placed on Pontoon, sea connections examined & found to be in good condition. Two new blades fitted to propeller tail shaft down 76" in Stern bush. Boilers examined several nuts found to be burnt off stay ends in comb. chrs. these have had new stays fitted, eight in all. Two patches in furnaces of Port boiler renewed, the remainder of boilers found to be in good condition. Superheater in good condition. Safety valves found in good condition & set under steam to 75 lbs per sq. in.

## General Observations, Opinion, and Recommendation:—

(State clearly what alteration, if any, is suggested to be made in the existing notification of the vessel's machinery in the Register Book, consequent upon this survey.)

& safe working condition renders the vessel eligible in my opinion to remain as classed than the notification B.S. 4. 85 recorded provided that the boilers are again examined within 12 months as per rule.

Office or Registration Fee (per Sec. 27) £ : :  
 Survey Fee (per Section 28) £ 1 : :  
 Special Damage Fee (per Section 28) £ : :  
 Certificate (if required) £ : :  
 Travelling Expenses (if chargeable) £ : :

received by me  
 22<sup>nd</sup> Apl. 1885


Geo. E. Miers  
 Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

TUESDAY 21 APRIL 1885

Assigned

B. S. 4 85

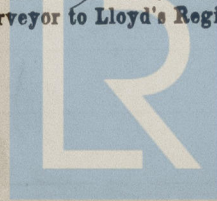

Lloyd's Register  
 Foundation

LON/674-0475



It is submitted that this vessel  
is eligible to have the notification  
B.S. 4.85 recorded the boilers  
being subject to resurvey as  
per Rule.

DP  
16/4/85.

