

Report of Survey for Repairs, &c., of Engines & Boilers.

(Received at London Office,

TUESDAY 29 DEC 1885

45729

No. 1015 in Survey held at London Date, first Survey 30 Nov Last Survey 18 Dec, 1885
 Reg. Book. 1015 on the Machinery of the S. S. Shark (Number of Visits 2)
 Tonnage, Gross 843 Built at Dundee When built 1864 7
 Ditto, Net 481 Owners General Steam & Co Port belonging to London
 Diameter of Cylinder 36 1/2 60 Engines made by Gowley Bros When made 1878
 Length of Stroke 30 Boilers made by (i) When made 1878
 Pressure of Steam 66 If Surveyed Afloat or in Dry Dock Deptford Dry Dock Classed A 1
 Registered Horse Power 185 (State Name of Dock.)
 Last Survey No. 1085 Port L.M.C. 12.82

Particulars of Repairs and Examination

Boiler Survey

(State clearly the cause of Repairs if any, and in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

Examined sea-cocks & connections & found them good
 Examined 2 main boilers & 2 domes & found them in a good condition. Several patches have been fitted.
 Examined high pressure and low pressure slides & cylinders and found them good.
 Examined crankshaft and found it good.
 Examined safety valves & found them good.
 They were found to blow at 65 lb.

General Observations, Opinion, and Recommendation:— The machinery, as far as seen, appears to be in a safe working condition and the vessel is in my opinion eligible to have the notification B.S. 12 '85 recorded in the Register Book.

Office or Registration Fee (per Sec. 27) £ : :
 Survey Fee (per Section 28) 8/1/85 £ 2 2 -
 Special Damage Fee (per Section 28) £ : :
 *Certificate (if required) £ : :
 Travelling Expenses (if chargeable) £ : :

received by me,
 27.1.1886


Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

FRIDAY 8 JAN 1886

Assigned

B.S. 12 '85

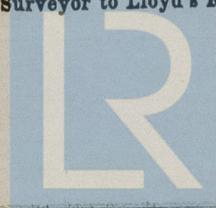

Lloyd's Register Foundation

LONG 76-0332

State if a Report is also sent on the Hull of the Ship.

Form No. 9 - Transfer Ink - 2000, 31/1/86. (The Surveyors are requested not to write on or below the space for Committee's Minute.)

Insert Character of Ship and Machinery precisely as in the Register Book.

It is submitted that this vessel
is eligible to have the notification
B.S. 12.55 recorded the boilers
being subject to resurvey as
per Rule.

DF
28/12/55

[Faint, illegible handwritten text, likely bleed-through from the reverse side of the page.]



© 2021
Lloyd's Register
Foundation