

Report of Survey for Repairs, &c., of Engines & Boilers.

(Received at London Office)

THURS 14 JAN 1889

No. 472 Survey held at London Date, first Survey Jan: 4 Last Survey Jan: 12 1886
 Reg. Book. 472 on the Machinery of the S. S. "Glenroy" (Number of Visits 2)
 Tonnage, Gross 2159 Built at Glasgow When built 1871-10
 Ditto, Net 1411 Owners Mc. Luga & Co. Port belonging to Glasgow
 Diameter of Cylinder 40" & 70" Engines made by Son. & Glas. Co. When made 1871
 Length of Stroke 42 Boilers made by 1879
 Pressure of Steam 75 lbs. If Surveyed Afloat or in Dry Dock Classed 100A1
 Registered Horse Power 250 (State name of Dock.)
 Last Survey No. Port L.M.C. 4.34

Particulars of Repairs and Examination For Annual Survey
 (State clearly the cause of Repairs if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

Vessel placed in dry dock & connections examined & found to be in good condition. Propeller disconnected. Tail shaft drawn, examined & found in good condition, the Stern bush renewed & the whole refitted. Examined two double ended main boilers, which were found to be in good condition. Safety valves in good condition.

Has submitted that this vessel is eligible to have B.S. 1.86 recorded as per Rule being subject to survey
As per Rule B.S. 1.86
14/1/86

General Observations, Opinion, and Recommendation:— *The boilers being now in good & safe working condition & the machinery as far as seen, the vessel is eligible in my opinion to remain as classed than the notification B.S. 1.86 recorded provided that the boilers are again examined within 12 mths. as per rule.*

Office or Registration Fee (per Sec. 27) £ : :
 Survey Fee (per Section 28) £ 1 : 1
 Special Damage Fee (per Section 28) £ : 5
 Certificate (if required) £ : :
 Travelling Expenses (if chargeable) £ : :

received by me
 19-2-1886


Geo. E. Wilkinson.
 Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

TUESDAY 2 FEB 1886

Assigned

B.S. 1.86

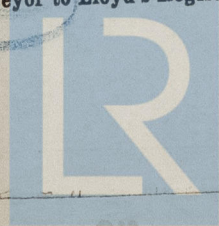

© 2021

Lloyd's Register
 Foundation

LONG 76-0432

Insert Character of Ship and Machinery precisely as in the Register Book.