


W/D 25-0261 1/2

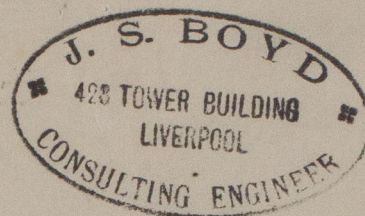

S.S. "THE LADY BELLE"

Notes taken with Mr Newton (Lloyds) on 8/7/49

Fore Well Deck, - Starbd bulwark rail renew

Paint locker bulkhead shell bar rivet.

Starbd forward deck plate A strake renew

Port side forward deck plate B strake renew.

Vent coaming on this plate renew.

No. 1 hatch, 4 wood covers renew, fit new bands to one.

Fore hold

No. 1 beam renew, starbd side with knee bracket.

Side frames, Starbd side, -

No. 6 web frame renew top, 3ft & weld, Web plate part renew.

No. 7 frame crop and renew top part & weld

No. 8 & 9 Reverse frames renew.

No. 10 frame renew.

No. 12 Web frame part renew.

No. 15 Reverse frame renew.

No. 18 web frame part renew.

No. 19 frame renew.

No. 20 beam knee renew.

Port side

Fore Peak Bulkhead wing plate renew.

No. 1 frame renew 6 ft at top

No. 6 Web frame, shell frame part renew

No. 7 Reverse frame renew.

No. 12 Web frame, shell frame renew.

No. 18 " " " " " "

No. 19 frame and beam knee renew.

Nos. 23 & 24 frames renew.

No. 11 carlin beam renew.

No. 14 " " fit reverse bar.

Fit reverse bars to beams under cabin.

Two shellplates Starbd side, forward of bridge in strake below sheer
strake to renew.

Fit doubler to bridge front 3'0" x 3'0"


Stanchion to upper bridge Port side crop & part renew.

No. 2 Hatch. Two wood hatches renew.

4 bulwark stanchions on R.Q. Deck renew.

No 2. Hold. Starbd, -

Nos 2.3.4.5.8.9.10.13.15 & 16 reverse frames part renew.

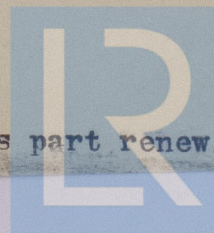


© 2020

Lloyd's Register
Foundation

The Lady Belle page 2.

b frames No. 6 & 11 reverse bars renew.
in deck stringer extension bracket plates renew Port & starbd.
rward beam renew in wings.
rt Side No 2 hold.
1 frame fit reverse to upper part.
3 frame renew.
s. 4, 5, 7, 9 Renew reverse bars at lower length'
11 reverse bar renew.
s. 12, 13, 14, 15 reverse bars part renew.
ling beams Nos 6, 7, 8, 14 port side and No. 14 Starbd side renew.

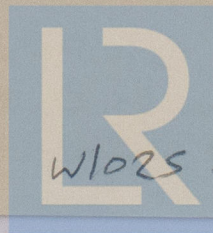

© 2020

Lloyd's Register
Foundation

W1025 - 0261 2/2