

al Surveys.
Shellenok

3m.1.37.

Received by Chief Ship Surveyor

Received from Chief Ship Surveyor

VESSEL'S NAME

"KUMARA"

Rpt.

Nwc.

No.

95385

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/32.)

The S.S.No.3, due 4,37, has been partly held.

The Newcastle Surveyors now report the vessel placed in dry dock, the bottom cleaned and coated and the Special Survey completed.

Repairs to casing, hatchways, ventilators and minor repairs effected.


The whole of the insulation, brine pipes etc., have been removed from the cargo spaces, together with refrigerating machinery and appliances and the connections blanked off as necessary.

The lower deck, with the exception of the stringer plating at sides, tie plating and shelf plating at bulkheads has been cut away except in No.3 hold, also pillars etc., all the arrangements being in accordance with the approved plan. (See also Special endorsement dated 11.9.37.)

The vessel has been converted to an Open Shelter Decker with tonnage opening etc., and the freeboard deck hatches fitted with 9" coamings etc.

The necessary material for the fitting of cargo battens in holds and tween decks has been supplied although these were not actually fitted at this time, and the Surveyors recommend a corresponding notation be made pending the fitting of the battens. (~~See also Special endorsement 11.9.37~~).

It is submitted the vessel appears worthy to remain as classed with record of survey 8,37, and notation of S.S.No.3-8,37.

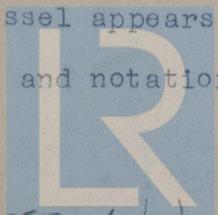

© 2020
Lloyd's Register
P.T.O.
Foundation

W104 - 0159 (1/2)

W10

John T

(2)

"KUMARA"

100A1 Shelter Deck with Freeboard
8,37 Bly.
S.S.Bly.No.3-8,37.

gld
17.9.37 *BR*
(M)

R.B. Amend to 2 Dks. (Stl.) and Shelter Dk. (Stl.) 3rd Dk. in No.4 hold
1 Dk. and Shelter Dk. 3rd Dk. in Nos.3 and 4 holds.
Amend to 8 BH to shelter deck
8 BH(Coll.BH to Shelter Dk.7 BH to 2nd Dk.)

X The Certificate of Classification to be endorsed "Cargo battens not fitted" and the same notation to be printed in the Register book. X note Alteration

Plating at 24 yrs etc



© 2020

Lloyd's Register
Foundation

W104-0159 (2/2)

not fitted" un...

Shelter Dk
+ LMC
PS.
+ LLOYD
Ch.
Non as
Shelter
14.52
tion
leane
red,
tan
as
after
T M
1 an
Vessels
from
from
tr
removed
C+
3B.
nd
nged)
mes
ro
nd
igging...
conseq
o have
N
the
on
2nd
not fitted" un...